## **Tech Tips**



## TT 27-15-01

Date: January 30, 2015

2014-2015 Passat, <mark>CC, EOS</mark>, Jetta<mark>, Golf, Beetle, Tiguan,</mark> Touareg - No Crank, No Start After Cold Soak

June 12, 2015: Update to Model Year/Information.

Concern may be the result of a leaking vacuum check valve not holding residual pressure overnight. This results in a hard brake pedal that may require more pressure than usual to allow the vehicle to crank. If duplicated, replace the vacuum supply line to the power brake booster, as the check valve is integral to the line. This will not affect power brake operation while driving.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.