

Tech Tips

TT 55-15-01

Date: July 3, 2015

2015 Golf/GTI-Hood will not open (release cable has come apart at the coupling)

Perform the following inspection and repair direction:



Hood latch release cable coupling located on the cross support bracket, above the driver's side headlight (Figure 1.)

Figure 1

For concerns of the hood will not open and it is found that the hood release cable came apart at the coupling (Figure 2), check the following:

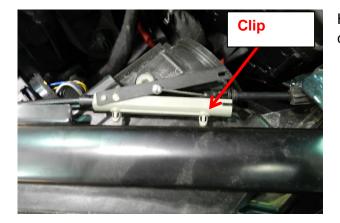


Figure 2

Hood latch release cable coupling that came apart at the coupling

Check if the coupling clips that install into the cross support bracket have broken (figure 2).

© 2015 Volkswagen Group of America, Inc.

Page 1 of 3

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.

Service Information



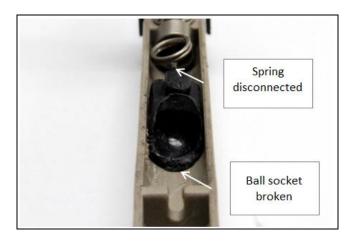


Figure 3.

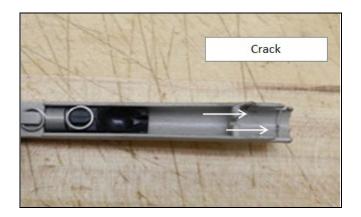


Figure 4.

Check if the ball socket is broken or the spring is disconnected.


Check for cracks.

© 2015 Volkswagen Group of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



Service Information

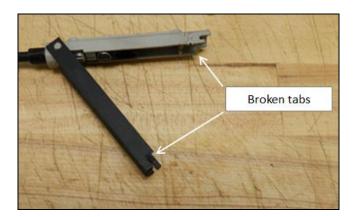

Check for broken tabs.

Figure 5.

If the coupling is not damaged, reassemble the coupling and install it to the cross support bracket using zip ties to secure it to the bracket (Figure 6).

If the coupling is damaged, replace the part and use zip ties to secure the new part to the support bracket.

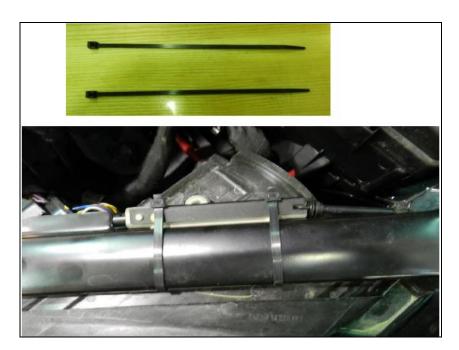


Figure 6.

© 2015 Volkswagen Group of America, Inc.

Page 3 of 3

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.