

Date	Expiration	Release	Page
04.2015	04.2017	3	1(2)

Revision B This version supersedes all previous releases
 June 02, 2015 Added vehicles not done in production.

OBD15 EMS AND CLUSTER PROGRAMMING

Prevost vehicles

DESCRIPTION

On the vehicles affected by this bulletin, perform software updates of the Engine Management System (EMS) and instrument cluster. The cluster update affects the beep sound level.

Some vehicles will need both systems updated. Other vehicles need either one update. Refer to table below.

MODEL YEAR(S) AND VEHICLES INVOLVED

NOTICE TO SERVICE CENTERS	
<i>Verify vehicle eligibility by checking warranty bulletin status with SAP or via ONLINE WARRANTY SYSTEM available on Service / Warranty tab of Prevost website.</i>	
Model	VIN
H3-41, H3-45 coaches Model Year : 2015	Cluster only: 2PCH33495 <u>FC712803</u> ; 2PCH33497 <u>FC712835</u> ; 2PCH33499 <u>FC712853</u> ; 2PCH33492 <u>FC712855</u> ; 2PCH3349X <u>FC712859</u> ; 2PCH33498 <u>FC712861</u> ; EMS only: 2PCH33494 <u>FC712923</u> ; 2PCH33496 <u>FC712924</u> ; 2PCH33491 <u>FC712927</u> ; 2PCH33491 <u>FC712930</u> ; 2PCH33493 <u>FC712931</u> ; 2PCH33495 <u>FC712932</u> ; 2PCH33497 <u>FC712933</u> ; 2PCH33499 <u>FC712934</u>
H3-45 VIP motorhomes Model Year : 2015	EMS only: 2PCV3349X <u>FC712945</u>
X3-45 coaches Model Year : 2014; 2015	Cluster only: 2PCG33493 <u>EC735538</u> ; EMS and Cluster : 2PCG33492 <u>FC735872</u> ; 2PCG33494 <u>FC735873</u> ; 2PCG33496 <u>FC735874</u> .
X3-45 VIP commercial use Model Year : 2015 - 2016	EMS and Cluster : 2PCCS349X <u>FC735877</u> ; 2PCG33491GC <u>735878</u> ; 2PCG3349X <u>GC735880</u>
X3-45 Commuter Model Year : 2015	EMS only: 4RKG33493 <u>F9737027</u> ; 4RKG33495 <u>F9737028</u>
This bulletin does not necessarily apply to all the above-mentioned vehicles, some vehicles may have been modified before delivery. The owners of the vehicles affected by this bulletin will be advised by a letter indicating the Vehicle Identification Number (VIN) of each vehicle concerned.	

MATERIAL NEEDED

No parts are required for this bulletin.

PROCEDURE



DANGER

Park vehicle safely, apply parking brake, stop engine. In the battery box, set the battery cut-off switch to the OFF position prior to working on the vehicle.

- 1) Instructions for vehicles having the **Cluster** tag in table, page 1:
 - In PTT, Go to parameter programming.
 - Set CNU parameter value to 10
 - Set NRF parameter value to 13.
- 2) Connect to vehicle with PTT. Perform EMS update as required.
- 3) Perform a DPF parked regeneration with PTT.
- 4) For vehicles having the **Cluster** tag, force low air warning light by pumping brakes with engine off. Then start vehicle. Confirm cluster beeps normally.

PARTS / WASTE DISPOSAL

Discard waste generated by activities according to applicable environmental regulations (Municipal/State[Prov.]/ Federal)

ESTIMATED TIME

The time required to perform this special bulletin is approximately one and a half hour.

OTHER

VBC Bulletin	N/A
Fail Code	04.04-1
Defect Code	09
System Condition	B
Causal Part	3092091

Prevost engages in a continuous program of testing and evaluating to provide the best possible product. Prevost, however, is not committed to, or liable for updating existing products.