


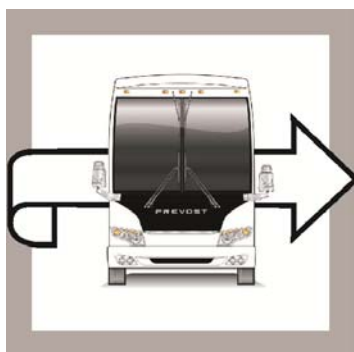

# PREVOST

## WARRANTY BULLETIN

### WB15-10A

|             |                                                        |           |             |
|-------------|--------------------------------------------------------|-----------|-------------|
| DATE :      | APRIL 2015                                             | SECTION : | 01 - Engine |
| EXPIRATION: | APRIL 2017                                             |           |             |
| SUBJECT :   | ENGINE OIL FLEXIBLE TUBE INSPECTION<br>AND REPLACEMENT |           |             |

Rev A, June 2015: Fail Code Modification

## APPLICATION

| <b>NOTICE TO SERVICE CENTERS</b><br><i>Verify vehicle eligibility by checking warranty bulletin status with <b>SAP</b> or via <b>ONLINE WARRANTY SYSTEM</b> available on Service / Warranty tab of Prevost website.</i>                                                                            |                                                                                                                                                                                                                                                   |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Model                                                                                                                                                                                                                                                                                              | VIN                                                                                                                                                             |
| H3-41, H3-45 coaches<br>Model Year : 2014 - 2015                                                                                                                                                                                                                                                   | From 2PCH33494EC71 <u>2595</u> up to 2PCH33494EC71 <u>2890</u> incl.                                                                                                                                                                              |
| H3-45 VIP motorhomes<br>Model Year : 2014 – 2015                                                                                                                                                                                                                                                   | From 2PCVS3491EC71 <u>2608</u> up to 2PCVS3499EC71 <u>2888</u> incl.                                                                                                                                                                              |
| X3-45 coaches<br>Model Year : 2014- 2015                                                                                                                                                                                                                                                           | From 2PCG33499EC73 <u>5611</u> up to 2PCG33492EC73 <u>5841</u> incl.                                                                                                                                                                              |
| X3-45 VIP commercial use<br>Model Year : 2014 - 2015                                                                                                                                                                                                                                               | From 2PCCS3492EC73 <u>5614</u> up to 2PCCS3494EC73 <u>5812</u> incl.                                                                                                                                                                              |
| X3-45 VIP motorhomes<br>Model Year : 2015                                                                                                                                                                                                                                                          | The following individual vehicles :<br>2PCBS3490EC73 <u>5740</u> , 2PCBS3495EC73 <u>5779</u> ,<br>2PCBS3498EC73 <u>5789</u> , 2PCBS3499EC73 <u>5798</u> ,<br>2PCBS3498EC73 <u>5808</u> , 2PCBS3497EC73 <u>5816</u> ,<br>2PCBS3490EC73 <u>5818</u> |
| This bulletin does not necessarily apply to all the above-mentioned vehicles, some vehicles may have been modified before delivery. The owners of the vehicles affected by this bulletin will be advised by a letter indicating the Vehicle Identification Number (VIN) of each vehicle concerned. |                                                                                                                                                                                                                                                   |

## DESCRIPTION

On the vehicles affected by this bulletin, inspect the lower oil fill tube flexible tube. If it is made of black material (EDPM), replace tube. Green and blue silicone hoses are accepted.

## MATERIAL

Order WB15-10 which includes the following parts:

| Part No. | Description             | Qty |
|----------|-------------------------|-----|
| 012933   | HOSE SILICONE POLYESTER | 1   |

### *NOTE*

*Material can be obtained through regular channels.*

## PROCEDURE



### **DANGER**

Park vehicle safely, apply parking brake, stop engine and set battery master switch(es) to the OFF position prior to working on the vehicle.

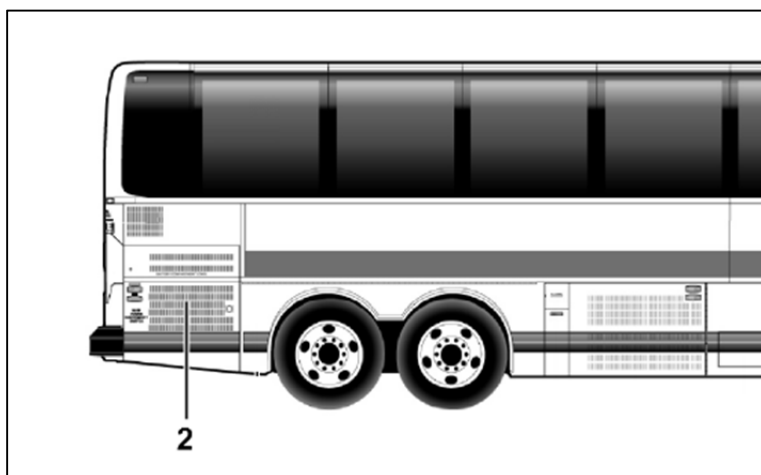


Figure 1

## **A: Inspection**

- Open curb side engine compartment door. (Item 2, Fig. 1)
- Visually inspect the lowest section of the oil fill tube. (Fig. 2) The hose connecting the steel tube to the oil pan should be green or blue. (Fig 3 & 4)
- If hose is black, perform replacement according to Step **B** below. Otherwise, this is the end of the bulletin.

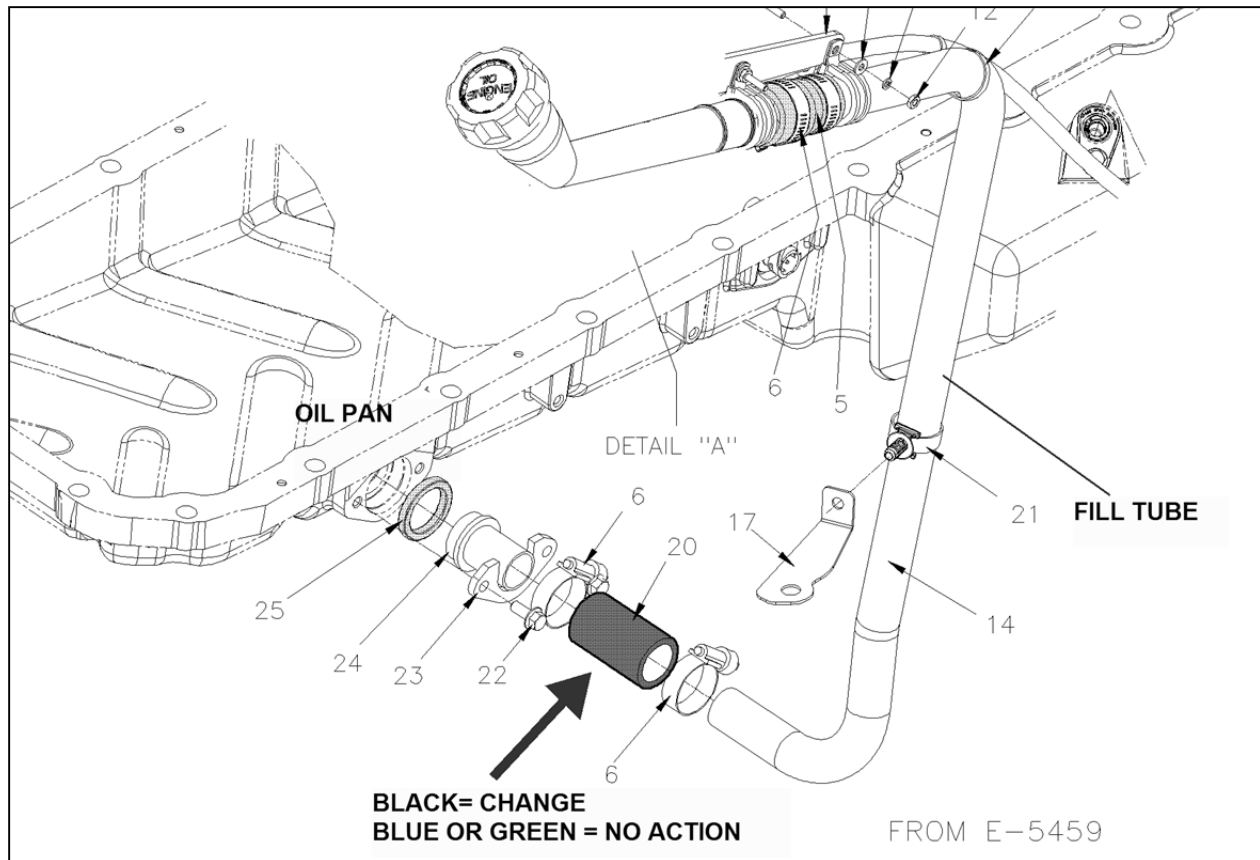


Figure 2

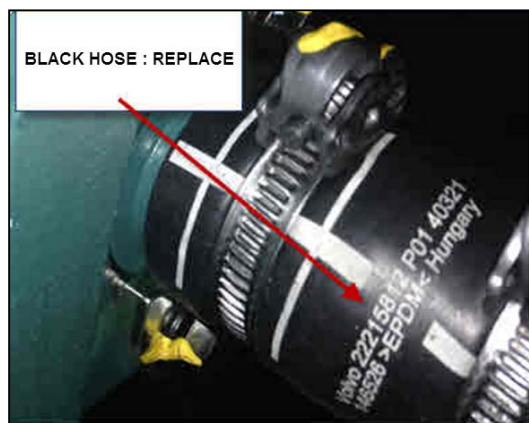


Figure 3



Figure 4

## B: Replacement instructions

- 1) Apply parking brake and block front wheels.(Fig. 5)

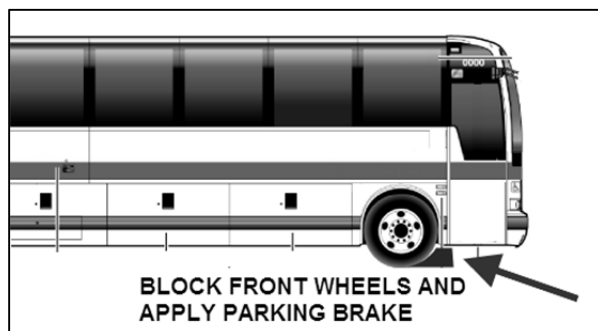


Figure 5

- 2) Using two mobile column lifts, jack vehicle about 38 cm (15 in) by drive axle to allow oil to move to the forward section of the oil pan.
- 3) Use a suitable container to collect any remaining oil that may drip while performing replacement.
- 4) Perform tube removal by undoing the two clamps. (Fig. 2) Dispose of tube according to regulations.
- 5) Install new tube 012933. Tighten clamps to 3,4 N-m (30 lbf-in).
- 6) Apply a torque seal of different color from the original seal to clearly mark change.
- 7) Lower vehicle. Confirm proper operation. Confirm installation is oil tight.

## PARTS / WASTE DISPOSAL

DO NOT RETURN THE REPLACED PARTS. Discard waste according to applicable environmental regulations (Municipal/State[Prov.]/ Federal)

## WARRANTY

This modification is covered by Prevost's normal warranty.

**Step A**, inspection only: we will reimburse you fifteen minutes (15 min) of labor. Or for **Steps A and B** we will reimburse you the parts and 3/4 of an hour (45 min) of labor, upon receipt of a warranty claim.

Please submit claim via our Online Warranty System, available at [www.prevostcar.com](http://www.prevostcar.com) (under Service \ Warranty section). Use Claim Type: "Bulletin/Recall" and select "Warranty Bulletin WB15-10".

## OTHER

|              |         |
|--------------|---------|
| VBC Bulletin | N/A     |
| Fail Code    | 01.00-2 |
| Defect Code  | 09      |
| Syst.Cond.   | B       |
| Causal Part  | 1136335 |

Access all our Service Bulletins on  
<https://secureus5.volvo.com/technicalpublications/en/pub.asp>  
or scan the QR-Code with your smart phone.

E-mail us at [technicalpublications\\_prev@volvo.com](mailto:technicalpublications_prev@volvo.com) and type  
"ADD" in the subject to receive our warranty bulletins by e-mail.

