


Secondary Fuel Filter
D11
VAH

FSB 233-005, Secondary Fuel Filter

(April 2015)

Under certain driving conditions, the secondary fuel filter in the VOLVO VAH D11 engine applications built from November 10, 2013 to March 27, 2015 may potentially be damaged by suspension tie rod interference with the bottom of the filter due to 14 mm lower ride height than earlier chassis builds.

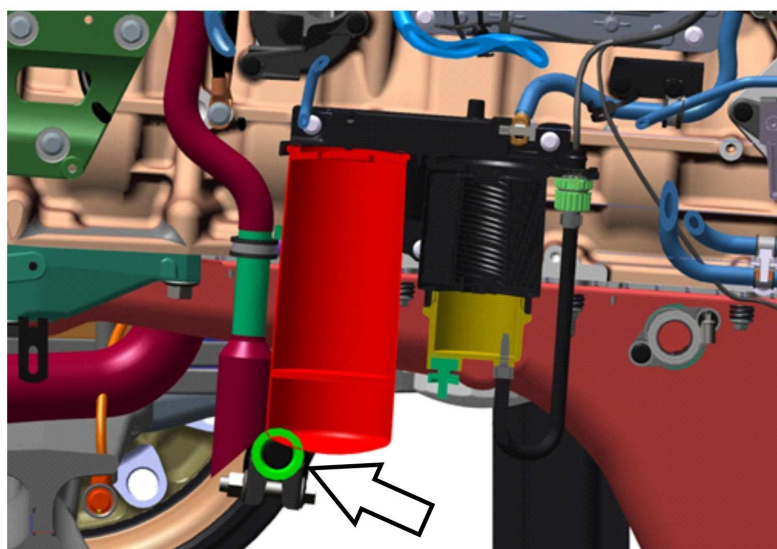

Potential tie rod contact point

Required Parts

Secondary Fuel Filter	Part Number
Long	21879886
Short	21632237

If a customer reports damage to the secondary fuel filter, part number 21879886 (long), replace it with part number 21632237 (91 mm shorter) or an equivalent filter of this length. This filter is also recommended even if no evidence of contact is noted on this chassis arrangement, due to the potential of contact based on load and road conditions. The shorter filter is the current VAH with D11 engine production arrangement starting March 27, 2015. Current published service intervals for this filter replacement still apply.

Service personnel: Please circulate, read and initial

Service Manager	Warranty Administrator	Workshop Foreman	Service Technicians						