

A PDF of this newsletter and previous ones can be found by logging in to ServiceNet and clicking on the [Elsa Newsletter](#) section in the Technician References menu.

VW Elsa Newsletter



Das Auto.

Edition 132: April 20, 2015

Content

- [Technical Bulletins](#)
- [Pending Service Solutions](#)
- [Tech Tips](#)
- [Campaigns](#)
- [Updates](#)
- [Suggestions](#)



Technical Bulletins

20 15 02 - 2031426 Supersedes T.B. V201501 dated March 2, 2015 to update test plan and add model year 2015 applicability.

High Pressure Fuel Pump Diagnosis

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
All	2008–2015	2.0L (CCTA, CBFA)	All	All	All

Engine Crank, No Start after Long Periods without Driving. Engine may run rough, and or MIL-ON with DTC P0087-low fuel pressure stored in ECM Fault Memory.

Production Solution: Not applicable.

24 15 04 - 2038161 Supersedes Technical Bulletin V241501 dated January 23, 2015 to include additional model years and models.

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
All	2008–2012	2.0T (CCTA,CBFA)	All	All	All

MIL ON, DTCs P2014 or P2015 Intake Manifold Faults Stored in ECM Fault Memory.

MIL ON and 1 or more of the following fault codes stored in the ECM fault memory:

DTC	Description
P2014	Intake manifold runner position sensor / switch circuit
P2015	Intake manifold runner position sensor / switch circuit range / performance

Production Solution: Improved intake manifold design.

26 15 02 - 2038752 MIL ON, Exhaust Flap Faults P048B, P048E, P0475, P0478, P0477 stored in ECM Fault Memory

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Golf	2015	2.0L TDI (CRUA)	All	All	All
Passat, Beetle, Beetle Convertible, Jetta	2015	2.0L TDI (CVCA)	All	All	All

DTC	Description
P048B	Exhaust Pressure Control Valve Position Sensor/Switch Circuit
P048E	Exhaust Pressure Control Valve Pos. Sensor/Switch Circuit High
P0475	Exhaust Pressure Control Valve "A"
P0478	Exhaust Pressure Control Valve "A" High
P0477	Exhaust Pressure Control Valve "A" Low

Production Solution: Not Applicable.

66 15 05 - 2040233 Supersedes Technical Bulletin V661504 dated April 1, 2015 to include special claiming code and VIN range.

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Golf R	2015	2.0L (CYFB)	All	AU1FW127111	AU7FW245826

Note: This Bulletin may only be applied as “one time only” for vehicles within 12 months of the original vehicle in-service date as stated in the Warranty Policy. (See section 1.3 General Guidelines/ Start of warranty period).

Vehicles not delivered with a **front** license plate bracket.

For states that require a front license plate, please use this document as a reference.

Production Solution: No production change required.

70 15 01 - 2040091 Instrument Panel Creaking Noise

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Passat	2014–2015	All	All	A3_EC000000	A3_FC054650

Customer may experience a noise in the right front area of the cabin when turning or on bumpy roads.

Production Solution: Strengthened rib around the Heat stake to prevent damage. (See Tech Bulletin for images)

Pending Service Solutions

No new Pending Service Solutions this week.

[Back to top](#)

Tech Tips

74-15-01 Passenger Side Heated Seat May Take Longer to Heat Up and Potentially be Lower in Temperature

Model(s)	Year	Eng.Code	Trans.Code
Passat, Jetta, Beetle	2011–2015	All	All

This is a normal characteristic of the vehicle as a result of the seat heating element being located below the Body Sense Mat for the passenger side air bag.

91-15-01 Vehicle Health Report Received by Customer Indicating a Concern. Cannot Verify any Conditions or DTC's to Facilitate Diagnosis

Model(s)	Year	Eng.Code	Trans.Code
All models equipped with Car Net (except Routan, Touareg)	2014–2015	All	All

Please contact the Volkswagen Technicians Helpline for additional assistance.

92-14-04 Rear Washer Jet Leaks - Drips After Use

Model(s)	Year	Eng.Code	Trans.Code
Golf A7	2015	All	All

For the A7 Golf with a rear washer nozzle leaking after use (Installed in the high mount brake lamp housing). An updated washer nozzle is now available. Replace with 5G0-955-993 or the latest ETKA supersession for this part number available.



[Back to top](#)

Campaigns

No new campaigns this week.

Updates

24BM UPDATE – 2.0L MPI Software Update (FED_EMS)					
Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Jetta	2011	2.0L MPI (CBPA)	MQ-250 (manual)	See Campaign/Action screen in Elsa	See Campaign/Action screen in Elsa
Jetta	2012–2014	2.0L MPI (CBPA)	All	See Campaign/Action screen in Elsa	See Campaign/Action screen in Elsa
<p>This update has been proactively released to revise the engine management strategy to the latest engineering levels.</p> <p>This UPDATE is in effect until removed. Vehicle must meet all of the following criteria:</p> <ul style="list-style-type: none">• Procedure is valid only for vehicles that show the 24BM code in Elsa, Campaign/Action Information screen <u>on the day of repair</u>.• If the vehicle is sold it must be within the FEDERAL EMISSIONS WARRANTY.• Procedure must be performed within the allotted time frame stated in this UPDATE.• Procedure must be performed on applicable vehicles in dealer inventory prior to sale.					

Suggestions

Please send comments or suggestions to: vwoa.workshopinformation@vw.com

[Back to top](#)

© 2015 Volkswagen of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.