

A PDF of this newsletter and previous ones can be found by logging in to ServiceNet and clicking on the [Elsa Newsletter](#) section in the Technician References menu.

VW Elsa Newsletter



Edition 139: June 8, 2015

Content

- [Wiring Diagrams Updates](#)
- [Technical Bulletins](#)
- [Pending Service Solutions](#)
- [Tech Tips](#)
- [Campaigns](#)
- [Updates](#)
- [Suggestions](#)



Wiring Diagrams Updates

"i-Wire has the capability of printing individual images.



[Back to top](#)

Technical Bulletins

87 15 05 - 2040811 Vibration or Rattling Noise from Front End or Dash Panel while Driving (PR No.: 9M3)

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
e-Golf	2015	All	All	AU_FW900001	AU_FW910277
<p>Customer states:</p> <ul style="list-style-type: none"> • Vibration/rattling noises from front end/dash panel after on acceleration. • Vibration/rattling noises from front end/dash panel with AC during idle. <ul style="list-style-type: none"> • Vibration/rattling noises from front end/dash panel while driving. <p>Production Solution: Introduction of vibration damper in production VIN AU_FW910278.</p>					

01 15 13 - 2037620 Supersedes Technical Bulletin V01 1416 dated July 29, 2014 to update part number and software levels. Update Programming ECM to Correct Engine Load Calculations

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Jetta, Passat	2014	1.8L (CPKA, CPRA)	All	All	All
Jetta, Beetle, Beetle Convertible	2013–2014	2.0L (CPPA, CPLA)	All	All	All
Beetle, Beetle Convertible	2013–2014	1.8L (CPKA, CPRA)	All	All	All
<p>Current ECM programing does not efficiently control engine valve timing causing stumbling and rough idle.</p> <p>Production Solution: Not applicable.</p>					

[Back to top](#)

Pending Service Solutions

No new Pending Service Solutions this week.

[Back to top](#)

Tech Tips


26-15-04 Selective Catalytic Reduction (SCR) System Repairs and AdBlue® Light Reset Procedure

Model(s)	Year	Eng.Code	Trans.Code
Passat, Beetle, Golf, Golf Sportwagen	2015	All	All

The adaptation value in the Engine Control Module (ECM), must be adapted with the Vehicle Diagnostic Tester whenever the reducing agent is drained or one of the following components listed below is replaced:

- Reducing agent tank
- Reducing agent pump
- Reducing agent injector
 - Reducing agent line
- Engine control module

Go to control module OBD / Select basic settings / Select Resetting adapt. Values of reduction agent sys.,comp.change. (RDID \$044C).

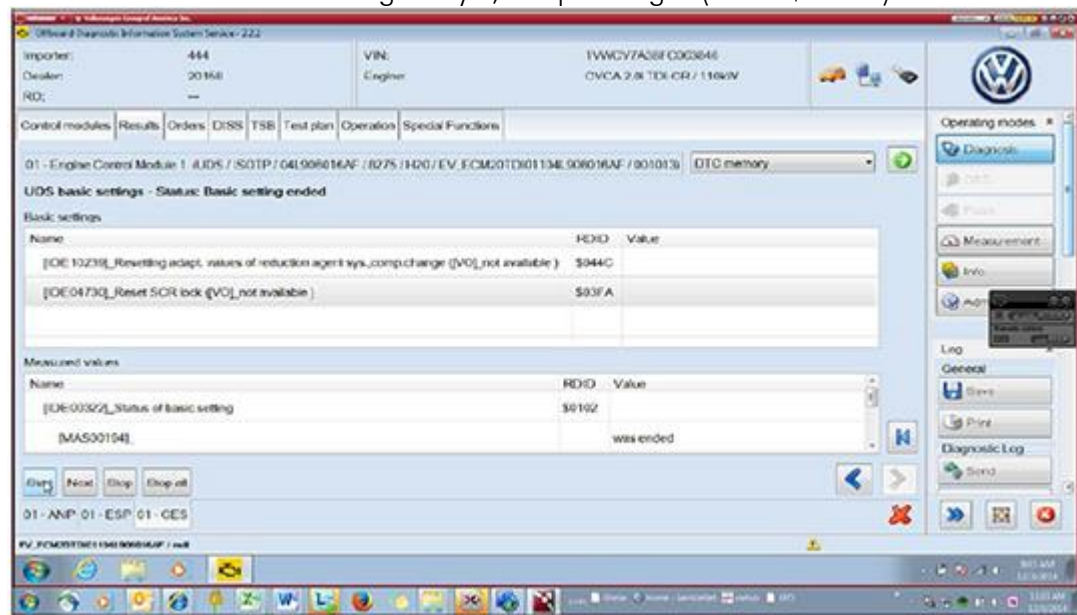

Campaigns

REVISION: 20T8 - Install Misfueling Guard					
Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Jetta, Jetta SportWagen	2009–2012	TDI® Clean Diesel	All	See Campaign/Action screen in Elsa	See Campaign/Action screen in Elsa
Golf	2010–2012	TDI® Clean Diesel	All	See Campaign/Action screen in Elsa	See Campaign/Action screen in Elsa
<p><u>Revision Summary</u> Expiration date extended for U.S. only.</p> <p>As diesel engine passenger vehicles become more popular, auto manufacturers have seen an increase in the number of misfueling cases where diesel engine vehicles are mistakenly fueled with gasoline. The resulting fuel system contamination can lead to costly repairs that are not covered under warranty.</p>					

01A5 - Vehicle Safety Certification Label					
Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Tiguan	2015	All	All	See Campaign/Action screen in Elsa	See Campaign/Action screen in Elsa
<p>The vehicle safety certification label is missing required tire pressure information, and required weights may have been incorrectly printed on the label. This is not in compliance with regulatory requirements. Missing tire pressure information on the vehicle safety certification label is not compliant with federal regulations; however this label is affixed to the vehicle in close proximity to the tire information label (which has the correct tire information identified for consumers). Incorrect weight information on the vehicle safety certification label may lead to vehicle overloading and adversely affect vehicle stability, which could result in a crash.</p>					

Updates

No new updates this week.

Suggestions

Please send comments or suggestions to: vwoa.workshopinformation@vw.com

[Back to top](#)

© 2015 Volkswagen of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.