Technical Service Bulletin



01 MIL on; DTCs for misfiring or electric faults for cylinder-specific components on bank 2 (cylinders 7–12)

01 15 41 2041733/1 August 21, 2015.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A8	2015	000001 - 038885	W12 engine

Condition

- MIL on.
- DTCs for misfiring or electric faults for cylinder-specific components on Bank 2 (cylinders 7–12) are stored in the engine control module, J623 (address word 01) or the engine control module 2, J624 (address word 11).

Technical Background

In the software for the engine control modules, the assignment of the DTC entries for misfiring or electric faults for cylinder-specific components does not match the cylinder assignment in ElsaPro.

For all model year 2015 A8 vehicles with W12 engines, note the following conversions (only listed cylinders are affected):

- Cylinder 7 \rightarrow Cylinder 12
- Cylinder 8 → Cylinder 11
- Cylinder 9 → Cylinder 10
- Cylinder 10 → Cylinder 9
- Cylinder 11 → Cylinder 8
- Cylinder 12 → Cylinder 7

Use the conversion table only for the following software versions:

Software part number	Software version
07P906027C	Below 8331

Production Solution

New software in the engine control module, J623 (address word 01) and the engine control module 2, J624 (address word 11) addressed the condition. The correct Bank 2 cylinder will be identified when the software level is 8331 or above; the conversion table is no longer needed.

Page 1 of 3

^{© 2015} Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.

Technical Service Bulletin



Service

Complete the Guided Fault Finding using the Bank 2 conversion table before the software update of the engine control modules, as performing the software update will delete the DTC entries.

After the software update, the Bank 2 conversion table is no longer needed.

SVM Update Instructions

- 1. Follow all instructions in TSB 2011732, 00 Software Version Management (SVM), operating instructions.
- 2. Update the engine control module, J623 (address word 01) and the engine control module 2, J624 (address word 11) using the SVM action code as listed in the table below, if necessary.

Model	Engine	Old Software Part Number	Old Software Version (or lower)		New Software Version (or higher)	SVM Code Input	
A8	6.3FSI	07P906027C	8330	07P906027C	8331	01A131	

Warranty

Claim Type:	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.				
Service Number:	2470				
Damage Code:	0039				
Labor Operations:	Software update of both control modules	2470 2599	Time stated on diagnostic protocol (Max 60 TU)		
Diagnostic Time:	GFF	No allowance	0 TU		
	Road test prior to service procedure	No allowance	0 TU		
	Road test after service procedure	0121 0004	10 TU		
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)				
Claim Comment:	As per TSB #2041733/1				

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual.* Claims are subject to review or audit by Audi Warranty.

^{© 2015} Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.

Technical Service Bulletin



Required Parts and Tools

Approved battery charger.

Additional Information

The following Technical Service Bulletin will be necessary to complete this procedure:

• TSB 2011732: 00 Software Version Management (SVM), operating instructions.

All part and service references provided in this TSB (2041733) are subject to change and/or removal. Always check with your Parts Dept. and service manuals for the latest information.

© 2015 Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.