

A PDF of this newsletter and previous ones can be found by logging in to ServiceNet and clicking on the [Elsa Newsletter](#) section in the Technician References menu.



Audi Elsa Newsletter

Edition 147: August 3, 2015

Content

- [Technical Bulletins](#)
- [Pending Service Solutions](#)
- [Campaigns](#)
- [Updates](#)
- [Suggestions](#)



Technical Bulletins

57 Emergency spare key missing at delivery (2041396/1)		
Model(s)	Year	Vehicle Specific Equipment
TT	2016-2017	Not Applicable
Condition: The plastic emergency spare key (part number 8S0837216A) was not delivered with the vehicle. Production Solution: Not applicable.		

[Back to top](#)

01 Coolant loss from coolant valve, engine warning light on, "Limp Home" mode active, cabin heating is insufficient (2033806/7)

Model(s)	Year	Vehicle Specific Equipment
A6, A7, A5	2012–2013	Not Applicable
A8	2010–2013	Not Applicable
Q7	2011–2014	Not Applicable
A5 Cabriolet, TT, A4, Q5	2012–2014	Not Applicable
Condition: The customer may have one or more of the following concerns: • MIL is on. • Climate system heating performance is insufficient. • Coolant level warning is on. • Engine temperature is elevated. • "Limp Home" mode is active. Production Solution: Improved coolant control valves are installed in production.		

91 Music cannot be played using AMI or USB media port with Android phones (2041178/1)

Model(s)	Year	Vehicle Specific Equipment
A3, TT	2016–2017	MIB
A6, A7	2015–2017	MIB
Condition: The customer is unable to play music when using the USB AMI cable connection (in A3 vehicles) or the USB media port (in A6, A7, or TT vehicles). Production Solution: Not applicable.		

[Back to top](#)

**91 Rearview camera intermittently inoperative (DTC 2203)
(2041430/1)**

Model(s)	Year	Vehicle Specific Equipment
A4, A5, A8, Q3, Q5	2013–2016	Rearview camera
Q7	2013–2015	Rearview camera
Condition: - The customer complains that the rearview camera image is not displayed on the MMI display. - DTC 02203 (audio/video input 1) is logged in the rearview camera system control module, J772 (address word 6C) with one of the following fault symptoms: 11 open circuit 8 implausible signal Production Solution: Not applicable.		

91 Generation 3 CAN radio: CD drive malfunction (2021780/5)

Model(s)	Year	Vehicle Specific Equipment
A4	2009–2016	Gen III CAN radio without navigation
A5	2008–2016	Gen III CAN radio without navigation
A5 Cabriolet	2010–2015	Gen III CAN radio without navigation
Q5	2009–2015	Gen III CAN radio without navigation
Condition: - A sequence of error messages is seen on the radio display screen after a CD was loaded into or removed from the internal CD drive. - After the ignition is cycled or a radio reset performed, the CD drive is fully operational. - DTC 00468 (CD-ROM Drive -R92- Faulty) is stored in the radio (address word 56). The DTC will be sporadic if the ignition has been cycled or a radio reset was performed, and will automatically be cleared after 40 ignition cycles without a reoccurrence.		

- Only vehicles with the CAN-based generation 3 radio (Concert (PR 8UQ) or Symphony (PR 8YN)) are affected.

Production Solution: Not applicable.

01 MIL on (DTC P20E800) (2040962/2)

Model(s)	Year	Vehicle Specific Equipment
Q5, A6, A7, A8	2014-2015	TDI clean diesel

Condition:

- MIL on.
- DTC P20E800 (Reductant pressure too low) is stored in the engine control module (ECM), J623 (address word 01).
- No relevant component or electrical problems are found when Guided Fault Finding (GFF) is run on the stored fault codes.

Production Solution:

- Software improvement with more robust onboard diagnostics.
- Optimized check valve in AdBlue delivery module. Additional checks at module supplier.
- New pumps pretested at supplier for pressure build-up behavior.

01 EPC light on (DTCs for cylinder pressure too high - P039B00, P03A500, P03AF00, P03B900) (2041261/1)

Model(s)	Year	Vehicle Specific Equipment
S3	2015	Not Applicable

Condition:

- EPC light is illuminated.
- One or more of several DTCs related to cylinder pressure is stored in the engine control module (ECM), J623 (address word 01).

Production Solution: Improved software.

[Back to top](#)

01 MIL on (DTC P2463, P2458, P244C) (2040489/2)		
Model(s)	Year	Vehicle Specific Equipment
A3	2015	TDI clean diesel
Condition: • MIL on. • One or more of the following DTCs is stored in the engine control module, J623 (address word 01): ◦ DTC P246300 (Diesel particulate filter (DPF) - Soot accumulation) ◦ DTC P245800 (Diesel particulate filter (DPF) - Regeneration duration) ◦ DTC P244C00 (Exhaust temperature too low for particulate filter regeneration bank 1) ◦ No relevant component or electrical problems are found when Guided Fault Finding (GFF) is run on the stored fault codes. Production Solution: Improved software with optimized soot load model.		

Pending Service Solutions

No new Pending Service Solutions this week.

Campaigns

No new campaigns this week.

Updates

No new updates this week

[Back to top](#)

Suggestions

Please send comments or suggestions to: aoa.workshopinformation@audi.com

[Back to top](#)

© 2015 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.