

Seat Cover Material Loose at Front Edge

Service Category Vehicle Interior

Section Seat

Market USA

Toyota Supports
 ASE Certification 

Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2013 - 2014	Avalon, Avalon HV	
2012 - 2014	Camry, Camry HV	

REVISION NOTICE

March 1, 2016 Rev1:

- The warranty information section has been updated.
- Any previous printed versions of this bulletin should be discarded.**

Introduction

Some 2012 – 2014 model year Camry/Camry HV and 2013 – 2014 model year Avalon/Avalon HV, Limited and XLE grade vehicles may exhibit a condition in which the front seat cover material has become loose at front edge of seat and is hanging below seat assembly. Reinstalling the seat cover does NOT permanently correct this condition. Follow the Repair Procedure in this bulletin to address this condition.

Production Change Information

This bulletin applies to vehicles produced **BEFORE** the Production Change Effective VINs shown below.

MODEL	PLANT	Engine	PRODUCTION CHANGE EFFECTIVE VIN
Camry	TMMK Line 1	2AR-FE	4T1BF1FK#EU360824
		2GR-FE	4T1BK1FK#EU025570
	TMMK Line 2	2AR-FE	4T1BF1FK#EU778961
		2GR-FE	4T1BK1FK#EU544716
Camry HV		2AR-FXE	4T1BD1FK#EU114015
Avalon	TMMK Line 1	2GR-FE	4T1BK1EB#EU093951
Avalon HV		2AR-FXE	4T1BD1EB#EU023745

Seat Cover Material Loose at Front Edge

Warranty Information

OP CODE	DESCRIPTION	TIME	OFF	T1	T2
BD1516	Reattach front cover and add hooks	0.5	71071-06C31-A0/B7 71071-06C91-A0/B7 71071-06D02-B3/E4 71071-06D12-B5/C5 71071-06D51-A0/B7 71071-06D62-B4/C4 71071-06J61-B1/E1 71071-07120-A3/B3/C3 71071-07131-A3/B3/C3 71072-07201-A2/B2/C2	62	57

APPLICABLE WARRANTY

- This repair is covered under the Toyota Basic Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.

Parts Information

PART NUMBER	PART NAME	QTY
71898-07050	Hook, Seat Cover	2

Repair Procedure

1. Confirm seat bottom cover material has separated from flange.

Figure 1.



Seat Cover Material Loose at Front Edge

Repair Procedure (continued)

2. Place one seat cover hook (U-Clip) 10 mm inward from edge of J-Hook as in Figure 2.
3. Repeat on opposite end of J-hook.

Figure 2. NEW part U-Clip


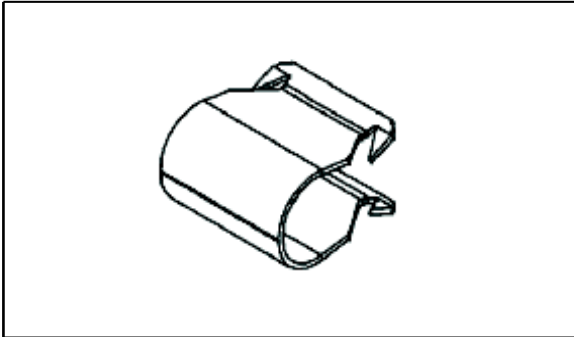


Figure 3.

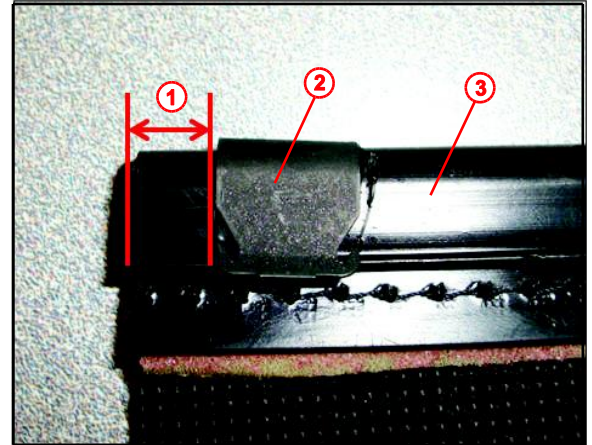

1	10 mm
2	U-Clip
3	J-Hook

4. Reinstall seat bottom cover material (J-Hook with additional U-clips) to seat frame flange.

NOTE

Ensure that both the J-Hook and U-Clips are fully seated on the seat flange.

5. Verify seat cover does NOT come loose with weight in the seat.