



Service Bulletin

PRELIMINARY INFORMATION

Subject: Diagnostic Tips on Poor Electrical Connection and/or Corrosion on the Speed Sensor Harness Connector Terminals

Models: 2014-2015 Cadillac ELR

The purpose of this PI is to inform dealership personnel that when inspecting, testing or replacing the speed sensor or harnesses, dielectric grease must be applied to the connector terminals to avoid future moisture, poor connection and corrosion. Apply dielectric silicone lubricant, P/N 12345579 (in Canada, P/N 10953529) or equivalent, into the connector to create a proper seal.

Note: Grease must be applied to all interface bases of the 3 connectors in the 3 in 1 inline connector on the Jumper harness. Also apply a sufficient quantity to fill the interface base of 1-2 mm depth.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION