
Light gap between roller blind and rear door window frame trim in upper position

Topic number	LI72.12-P-060707
Version	1
Design group	72.12 Rear door
Date	01-27-2015
Validity	BR222 with code 297
Reason for change	
Reason for block	

Complaint:

Light gap between roller blind and rear door window frame trim in upper position.

Cause:

When the roller blind is being raised, if an obstruction is detected in the last 10mm (e.g. a trapped foreign object), then this is saved as the uppermost position of travel.

Remedy:

Normalization of rear door roller blind; see graphic, Figure 1.

1. Move roller blind to halfway position.
2. Operate a short distance down, up, down and up again.
3. Move roller blind all the way up. This completes the normalization process.

Note:

The system is renormalized automatically after every 20 actuations.

Note:

The roller sun blind must not be replaced on account of this complaint.

Attachments	
File	Description
Bild 1.JPG	Figure 1

Symptoms
Body / Interior equipment / Sun protection / Roller sun blind, side window / Does not move in/out
Body / Interior equipment / Sun protection / Roller sun blind, side window / Does not remain in end position

Work units				
Op. no.	Operation text	Time	Damage code	Note
			81B03 42	
			81P03 42	

Validity		
Vehicle	Engine	Transmission
S (222)	*	*

Attachments

Bild 1.JPG:

