

Water deflector to panoramic roof - narrow opening

Topic number	LI88.85-P-061066
Version	1
Design group	88.85 Trim strips
Date	03-16-2015
Validity	Model series 222 with code 413 As of VIN end no.: A073262 Up to VIN end no.: A134154
Reason for change	
Reason for block	

Complaint:

Narrow opening at water deflector to panoramic roof.

Cause:

Unevenly bonded side seal at panoramic roof.

Remedy:

Detach the water deflector.

Bend the mounting tabs of the front water deflector, see picture 1, by approx. 2-3 mm toward the vehicle interior.

Attach the water deflector.

Attachments	
File	Description
Bild 1.JPG	Figure 1

Symptoms

Body / Body/Cab / Trim strip/cover / Inaccurate fit

Body / Roof system / Panoramic sunroof / Deformed

Work units

Op. no.	Operation text	Time	Damage code	Note
			78A06 K8	
			78N06 K8	

Validity

Vehicle	Engine	Transmission
---------	--------	--------------

222.004	*	*
222.032	*	*
222.033	*	*
222.057	*	*
222.067	*	*
222.077	*	*
222.082	*	*
222.085	*	*
222.104	*	*
222.123	*	*
222.132	*	*
222.133	*	*
222.157	*	*
222.162	*	*
222.163	*	*
222.165	*	*
222.167	*	*
222.176	*	*
222.177	*	*
222.178	*	*
222.179	*	*
222.182	*	*
222.184	*	*
222.185	*	*
222.967	*	*
222.976	*	*
222.982	*	*
222.985	*	*

Attachments

Bild 1.JPG:

