

Slight oil leakage at single stage transmission

Topic number	LI26.40-P-061280
Version	1
Design group	26.40 Housing
Date	04-14-2015
Validity	smart ev transmission up to VIN WME4514901K7918531 or up to production date 14.04.2014
Reason for change	Switzerland and Austria country allocation added
Reason for block	

Complaint:

Slight oil leakage through the breather hole at the top of the transmission (only affects vehicles up to VIN WME4514901K791853, or up to production date 14.04.2014)

Cause:

Slight oil leakage at the breather (breather spitting) can occur sporadically under certain driving conditions.

Remedy:

Replacement of breather tube.

Please verify in advance that the problem is breather spitting (and that e.g. the side drive shafts can be ruled out)..

Attachments	
File	Description
Einbauanweisung_deutsch_englisch_V2.pdf	Rep. instructions

Symptoms
Power transmission / Differential / Rear axle differential / Rear axle differential, leaks / Oil ejection
Power transmission / Manual transmission / Manual transmission / Manual transmission, leaks / Leaks
Power transmission / Manual transmission / Automated Manual Transmission, Sequentronic ASG / ASG leaks / Leaks

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 451 351 03 00			Breather tube	1		X
A 451 351 02 00			Breather connection	1		X

Work units				
Op. no.	Operation text	Time	Damage code	Note

			2601G 04	
--	--	--	----------	--

Validity		
Vehicle	Engine	Transmission
451.390	*	*
451.392	*	*
451.490	*	*
451.492	*	*