

Touchpad - Operation of head unit via touchpad (A105) not possible

Topic number	LI82.60-P-059737
Version	4
Design group	82.60 Radio, audio/video systems
Date	05-27-2015
Validity	BR205 with code 522 or code 531 up to production date 02/15 BR222 with code 805 or code 448 up to production date 02/15 BR217 with code 805 or code 448 up to production date 02/15
Reason for change	Remedy/cause/validity adjusted
Reason for block	

Complaint:

The head unit cannot be operated using the touchpad (A105).

The touchpad (A105) does not respond to any touches or does so only sporadically.

Cause:

Drift of the sensor values compared with calibration at the supplier.

Remedy:

Update software of touchpad control unit (A105) using Xentry DVD 05/2015 or higher and follow the path below.

-> Control units view

-> Information and communications

-> Touchpad (A105)

-> Adaptations

-> Control unit programming

Symptoms

Communication/information / Entertainment / Overall system/system error / System cannot be operated/audio and video present

Communication/information / Entertainment / Overall system/operation / Button nonfunctional

Communication/information / Entertainment / Audio/COMAND controller / Nonfunctional

Work units

Op. no.	Operation text	Time	Damage code	Note
54-0991	CONTROL UNIT: TOUCHPAD (A105): INSTALL SOFTWARE	4AW	8271R E9	

Validity		
Vehicle	Engine	Transmission
205.002	*	*
205.003	*	*
205.004	*	*
205.008	*	*
205.009	*	*
205.012	*	*
205.036	*	*
205.037	*	*
205.040	*	*
205.042	*	*
205.045	*	*
205.049	*	*
205.066	*	*
205.140	*	*
205.142	*	*
205.145	*	*
205.204	*	*
205.208	*	*
205.209	*	*
205.212	*	*
205.236	*	*
205.237	*	*
205.240	*	*
205.242	*	*
205.245	*	*
205.266	*	*
222.004	*	*
222.032	*	*
222.033	*	*
222.057	*	*
222.067	*	*
222.077	*	*
222.082	*	*
222.085	*	*
222.104	*	*
222.123	*	*
222.132	*	*
222.133	*	*
222.157	*	*
222.162	*	*

222.163	*	*
222.165	*	*
222.167	*	*
222.176	*	*
222.177	*	*
222.178	*	*
222.179	*	*
222.182	*	*
222.184	*	*
222.185	*	*
S (217)	*	*