

Uncomfortable 1-2 and 3-2 shifts in MO- DEL 166 (ML) with ENGINE 276.955

Topic number	LI27.00-P-060968
Version	5
Design group	27.00 General
Date	06-19-2015
Validity	MODEL 166 (ML) with ENGINE 276.955 up to and including CODE 803 and without CODE 430 (Off-road engineering package). Only valid for transmission control unit VGS3.
Reason for change	Validity adapted.
Reason for block	

Complaint:

Under certain circumstances the 1-2 upshift and/or the 3-2 downshift can be uncomfortable.

Cause:

Software application of transmission control unit VGS3

Remedy:

Install the transmission software A 000 902 60 21 or a later version. The software is available with add-on 4294 for Xentry DVD 12/2014.

For vehicles with CODE 430 (Off-road engineering package) the software is not applicable.

Symptoms
Power transmission / Automatic transmission / Automatic transmission - function / Poor shift quality

Work units				
Op. no.	Operation text	Time	Damage code	Note
			27012 45	1-2 upshift uncomfortable
			27017 45	3-2 downshift uncomfortable
54-0650	MAINTAIN 12V			
54-1011	QUICK TEST			
54-0991	SOFTWARE			

Validity		
Vehicle	Engine	Transmission

M/GLE (166)	276.955	722.906
-------------	---------	---------