



Service Bulletin

TECHNICAL

Subject: Paint Chip on Right Rear Quarter Panel Due to Contact from Rear Compartment Lid

Attention: This Bulletin also applies to any of the models that may be Export vehicles.


Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Camaro	2016	2016			All	All

<p>Condition</p>	 <p>Some customers may comment on the paint being chipped on the quarter panel near the lower edge of the back glass.</p>
<p>Cause</p>	<p>This may be caused by an alignment issue of the rear compartment hinges, causing the rear compartment lid to contact the quarter panel during operation.</p>

Correction

If you encounter a vehicle with the above concern, follow the procedure outlined below.

1. Adjust the rear compartment lid by completing the following steps:

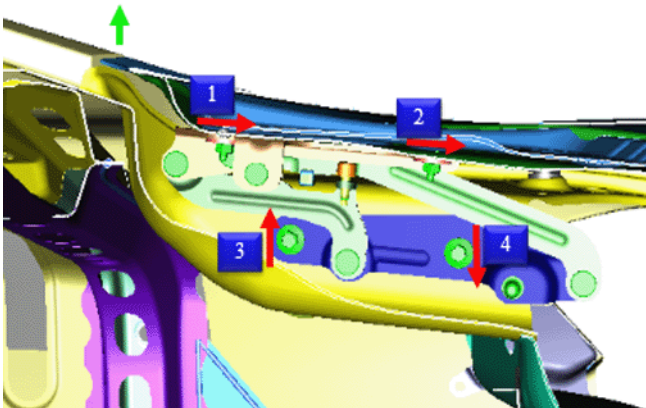

- 1.1. To adjust the compartment lid height, loosen both body side bolts (3 and 4) and take the forward one up and rearward one down.
- 1.2. To adjust the compartment lid gap, loosen the rear compartment lid side bolts (1 and 2) and pull the rear compartment lid aft.

- 1.3. Adjust the rear compartment lid in order to obtain an even gap between the rear compartment lid and the quarter outer panel, the rear tail lamp and the rear bumper fascia and so that the rear compartment lid is flush with the quarter outer panel, the rear tail lamp and the rear bumper fascia.

Adjustments

- Rear compartment lid to quarter outer panel (a) 3.0 mm ± 0.75 mm (0.12 in ± 0.03 in)
- Tail lamp to rear compartment lid (b) 6.25 mm ± 1.5 mm (0.25 in ± 0.06 in)
- Rear compartment lid to rear bumper fascia (c) 6.0 mm ± 1.5 mm (0.24 in ± 0.06 in)

Tighten

- 9 Y (80 lb in)

2. Once the rear compartment lid is adjusted, apply a small amount of touch up paint to the sections of the quarter panel, hinge nuts and rear compartment lid that have had the paint damaged.

Parts Information

For paint part numbers and usage, refer to Group 08.800 of the appropriate GM Parts Catalog.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
1480598*	Adjust Rear Compartment Lid and Apply Touch Up Paint	0.5 hr
*This is a unique Labor Operation for Bulletin use only.		

Version	1
Modified	

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION