



Service Bulletin

INFORMATION

Subject: Diagnostic Information for DTC P175F

Attention: This Bulletin also applies to any of the models that may be Middle East Export vehicles.

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	XTS	2014	2014			3.6L Engine (RPO LF3)	6T80 Automatic Transmission (RPO MHM)

Condition	Technicians may find DTC P175F active in the Transmission Control Module (TCM). This is a Type C DTC and will not illuminate the MIL. This DTC has no impact to the customer and no transmission driveability concerns will be noted as a result of this DTC being observed.
Cause	This DTC may be set as a result of updating the TCM Service Calibration. The diagnostic is looking for a signal that is not available in MY14.

Correction

Do Not clear this DTC. Clearing this DTC will only result in it setting again. If this DTC is found as active or in history, it should be disregarded. No parts should be replaced or calibrations updated to correct this DTC.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION