



# Service Bulletin

## PRELIMINARY INFORMATION

**Subject:** DTCs P0128, P0133, P2002, P20EE, P22FA, P2463 Set, DEF Fluid Quality Poor Message On and/or Cruise Control Interrupt at Low Speeds

**Models:** 2014 Chevrolet Cruze  
Equipped with 2.0L Diesel Engine (RPO LUZ)

*This PI has been revised to include DTC P2002 and update the Condition/Concern. Please discard PI1484A.*

### Condition/Concern

Some customers may comment on one or more of the following conditions:

- The cruise control will disengage at low speeds.
- The cruise control will disengage when traveling down hill.
- A "DEF Fluid Quality Poor" message on.
- A malfunction indicator lamp (MIL) is on.

Technicians may find DTCs P0128, P0133, P2002, P20EE, P22FA, P2463 set or in history.

This may be caused by a software anomaly.

### Recommendation/Instructions

Technicians should repair as per SI based on the DTC set and then reprogram the ECM to prevent reoccurrence.

Perform a fuel trim reset using a scan tool after programming is complete.

### Warranty Information

For vehicles repaired under warranty, use appropriate labor operation for the repair performed. Submit Labor Operation 2881008 for Engine Control Module Reprogramming with SPS at 0.4 hr.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION