



# Service Bulletin

## PRELIMINARY INFORMATION

**Subject:** Service Front Camera or Tire Learning Active Message on DIC at Start Up

**Models:** 2014 Chevrolet Impala (VIN 1)

**Attention:** This PI also applies to any of the above models that may be Middle East Export vehicles.

*This PI has been revised to update the Condition/Concern. Please discard PI1383.*

### Condition/Concern

Some customers may comment on a DIC message of "Service Front Camera" or "Tire Learning Active" at start up.

This message may go away after one or more key cycles.

The forward collision alert and the tire pressure monitoring systems continue to function as design intended.

### Recommendation/Instructions

An updated software calibration has been released to address this condition.

Update the cluster using the Service Programming System (SPS) procedure in SI with the latest calibrations available on TIS2WEB.

### Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
2810195	Instrument Cluster Reprogramming with SPS	Use Published Labor Operation Time

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION