



Service Bulletin


PRELIMINARY INFORMATION

Subject: Sharp Metal Edge Across Top of Rear Compartment Opening (Rear Window Panel)

Models: 2013-2015 Chevrolet Malibu

This PI has been revised to add the 2014-2015 Model Years. Please discard PI1185.

Condition/Concern

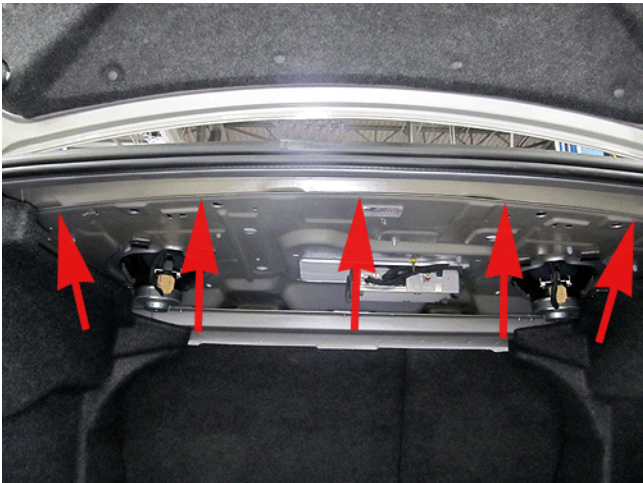


Some customers may comment that there is a sharp metal edge across the inside top area of the rear compartment opening. During the manufacturing process, a metal burr may have been left on the rear edge of the rear window panel.

Recommendation/Instructions

Warning: When working with sheet metal with exposed or rough edges, wear approved safety glasses and gloves in order to reduce the chance of personal injury.



Install a protective cover (sealing strip) on the edge of the rear window panel as shown.

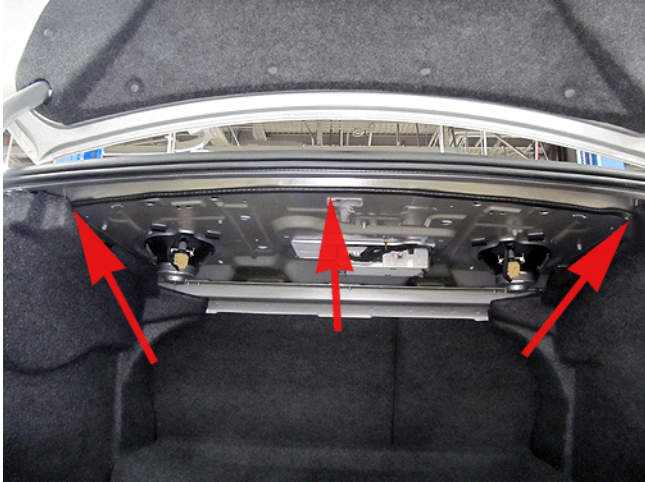

Ensure the sealing strip covers the complete edge between the left and right trunk side panel trim.

Parts Information

Part Number	Description	Quantity
23452494	Sealing Strip	1

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
1480218*	Install Rear Compartment Sealing Strip	0.2 hr

*This is a unique Labor Operation for Bulletin use only. It will not be published in the Labor Time Guide.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION