



No.: 15 TS-5Rev
February 3, 2015

TO: Service Locations

FROM: Service Systems Development

SUBJECT: **GHG14 DD Platform DEF Pump Leaks and Code 4374/FMI 0 Under Pressurized DEF System**

ISSUE

Detroit has identified DEF pump leaks from the filter housing and visible on the plastic housing. The frost protection membrane tears, causing DEF to leak from the filter housing. The fault code associated with this failure is SPN 4374/FMI 0 – DEF Pump Speed High.


REQUIRED ACTION

Inspect the DEF pump housing for signs of DEF leaks in the area defined by the photo 1.
Remove the frost protection membrane and turn it inside out to identify tears similar to photo 2.
Replace the membrane as necessary using the kit part number below:

Filter Insert - DDE A0001420789

NOTE:

DO NOT replace the DEF pump.

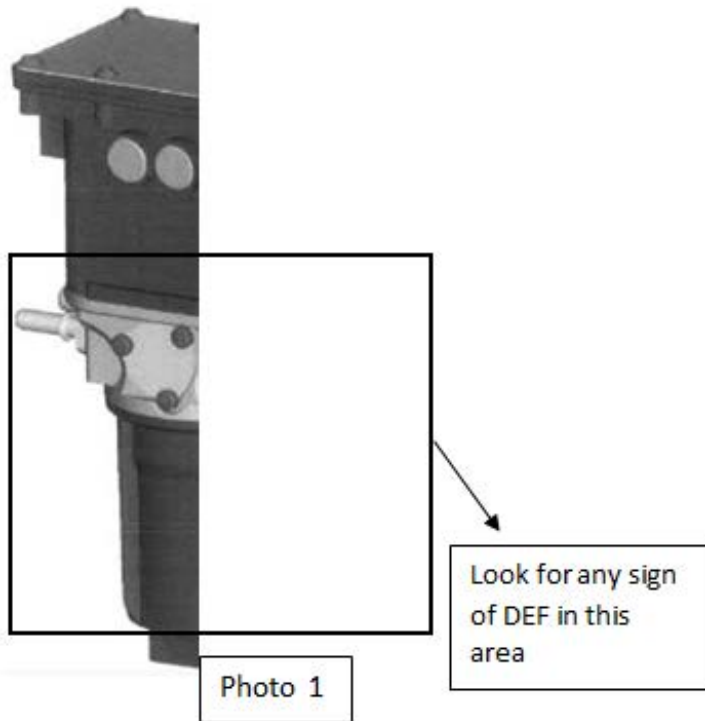

CONTACT INFORMATION

Please contact the Detroit Customer Support Center at 800-445-1980 or email csc@daimler.com if you have any questions.