



BAHAMAS, BOLIVIA, BELIZE, CANADA, CHILE, TAIWAN, COLOMBIA, COSTA RICA, DOMINICAN REPUBLIC, ECUADOR, EL SALVADOR, TRINIDAD AND TOBAGO, UNITED STATES, URUGUAY, VENEZUELA, ARUBA, NICARAGUA, PERU, PUERTO RICO, Curaçao, GUAM, GUATEMALA, GUYANA, HAITI, HONDURAS, JAMAICA, KOREA, SOUTH KOREA, PANAMA

Countries:

Availability: ISIS, Bus ISIS, FleetISIS

Major System: ENGINES

Current Language: English

Other Languages: NONE

Viewed: 14448

Document ID: IK1200655

Revision: 9

Created: 10/7/2011

Last Modified: 8/18/2015

Author: Ryan Hendrickson

[Less Info](#)

Hide Details

Coding Information

Copy Link	Copy Relative Link	Bookmark	Add to Favorites	Print	Provide Feedback	Helpful	Not Helpful
		 View My Bookmarks				 950	 486

Title: Injection Pressure Regulator (IPR) Pigtail

Applies To: MaxxForce 07-09 and 2010 DT, 9, & 10 engine builds and later (ESN 3000000 to 3999999)

CHANGE LOG

Please refer to the change log text box below for recent changes to this article:

08/18/2015 - Changed ESN 3300000-andup to ESN 3300000 - 3999999

2010 and later Maxxforce DT, 9 and 10 Engines

ESN 3300000 - 3999999

IPR KIT 1889325c94

- A new IPR Kit has been released. The new style has a remote mounted connection 7 inches from the IPR valve (figure 2).
- **The connection at the IPR valve is no longer serviceable and disassembly should not be attempted (figure 2).**
- The kit includes a new IPR valve, IPR pigtail, zipties, butt connectors, convolute, and directions for installing the new IPR (figure 3).
- The IPR Solenoid needs to be clocked properly, refer to the included instruction sheet for proper installation.
- The new style IPR requires the use the new tool 12-800-01(see figure 4 below)
- Tool instructions are available on the Service Tool Resource Center (TL2900008).

 


Figure 2: IPR With new connector

1. Not servicable: Do not attempt to disconnect
2. Remote mounted connector.

**Figure 3: Kit contents**

1. Pigtail
 2. Zip ties
 3. Injection Pressure Regulator
 4. Convolute
 5. Butt connectors and Heat shrink.
- (Directions not pictured)

Tool Number: 12-800-01

**Figure 4: Glued IPR valve requires Tool # 12-800-01**

2007-2009 Maxxforce DT, 9 and 10 Engines

ESN 3000000-3299999

Complaint

- Engine Stall
- No Start
- Erratic ICP
- ICP related codes
- Rough engine idle

Cause

- IPR pin fretting increases resistance at IPR connection.

TROUBLESHOOTING

- Perform "wiggle" test of IPR wiring and listen for any change in engine tone as well as running condition, and engine stalling.
- Disconnecting/reconnecting of IPR connector may alter symptom.
 - With the engine off
 - Disconnect, reconnect, and retest.
 - Note any changes in operation characteristics.
- Visually inspect for signs of wear, fretting, deformation, or material transfer between contacts
- If the condition is still present then load test the IPR wires individually (Pin 1 and Pin 2).

RESOLUTION

- Replace IPR valve and/or pigtail; leave generous length of wire to allow movement. The IPR pigtail service part must have a 90mm wire tail between the IPR connector and the wiring harness. See Figure 5 below.
 - Use a generous amount of Dielectric Grease.
- TEST alteration



Figure 5: IPR pigtail and IPR Valve showing the necessary bend in the wire to prevent future fretting.

IPR Pigtail Part Number: 2501107C1*

***NOTE: New Pigtail Part Number. All pigtails now have Green wires.**



Figure 6: Examples of damage to the IPR valve pins and connector

Hide Details

Feedback Information

Viewed: 14447

Helpful: 950

Not Helpful: 486

Staff ID	Client ID	Comments	Created Date
	DY08955	You received the following feedback From: dy08955 - David Gabrielle Email Address: gabe396@aol.com Job Classification: SE008, Service Technician Dealer: TRUCK KING INTL IDEALEAS Feedback: It would be helpful if you provided a photo of the completed pigtail wiring modification, showing where you'd recommend tie strapping the replacement IPR pigtail connector retainer displayed in Figure 3.	8/19/2015 6:08:11 AM