

Measure no.

US 60981339-01

Subject

Aluminium Case Does Not Fit Correctly

Status date (mm/dd/yy)

3/19/15

Status

Accepted

Organization

US, MOT

Date created (mm/dd/yy)

3/19/15

Created by

Christine Koehling

PQM Problem reference**Release date (mm/dd/yy)****Approved by****Dealer release**

Allow automatic release

Vehicles affected**E series**

K51

Engine**Body****Production period (from/to)**

(mm/dd/yy)

/ 2/28/15

Comment on production period**Feedback (all cases relating to****measure up to) (mm/dd/yy)**

Complaint

When attempting to attach the case to the case mount, it does not fit properly;
this can cause the lock not to operate and/or the key to break off if excessive
force is applied.

Cause

Fault with the welding jig resulting in improperly aligned tabs on the case mount.

Measure

Picture 1 shows the mount with the four tabs that engage the case.

Picture 2 shows a tab that is properly aligned.

Picture 3 shows a tab that is improperly aligned.

If the mount is defective, as shown in picture 3, order a new mount and claim under
warranty

Complaint**Fault location**

P-

Locking / unlocking case

Fault type

not mountable

Fault place

Rear right

Fault conditions

when locking

Cause

#	Fault location	Fault type	Fault place
1	46/54 Case holder	Incorrect fit	Right
Repair Task		Special Clearance	Area
Replace		No	Body and Trim

Fault code

Progman / DIS / ISTA / ISTA/P

System	State	Version
--------	-------	---------

© 2002-2015 BMW OF NORTH AMERICA, LLC. ALL RIGHTS RESERVED.

1



2



3

