



This Service Information bulletin supersedes SI B63 12 14 **dated December 2014**.

NEW designates changes to this revision

SUBJECT

Check Control Message with Rear Light Failure

MODEL

F25 (X3)

SITUATION

Intermittently, a Check Control Message (CCM) is displayed for one or more rear light failures:

- Rear light
- Brake light
- Rear indicator

One or more fault codes are registered in the Footwell Module (FRM) for one or more circuits with the fault not currently present:

- **NEW** 800F46 - Indicator rear left defective
- **NEW** 800F47 - Indicator rear right defective
- **NEW** 800F56 - Brake light left defective
- **NEW** 800F57 - Brake light right defective
- **NEW** 800F80 - BFD left defective
- **NEW** 800F81 - BFD right defective
- **NEW** 802812 - Brake light / direction indicator, left: light faulty or open circuit
- **NEW** 802813 - Brake light / direction indicator, right: light faulty or open circuit
- **NEW** 800F7A - Reversing light left defective
- **NEW** 800F7B - Reversing light right defective

CAUSE

Bad connection at the rear light in the tailgate and/or rear light in the side panel

PROCEDURE

To avoid a repeat visit to the workshop, in addition to the test plan recommendations, pay attention to the attachment, which contains additional troubleshooting hints.

See the attachment for repair hints.

WARRANTY INFORMATION

If performing ISTA diagnostics, the related test plans and/or the troubleshooting hints outlined in this Service Information bulletin result with eligible and covered work, claim this work with the applicable defect code(s) and labor operations listed in KSD2.

ATTACHMENTS

View PDF attachment [B631214 Repair Hints.](#)

[Copyright ©2015 BMW of North America, Inc.]