


SUBJECT
Water Leak in the Right Rear Luggage Compartment Area
MODEL

E84 (X1)


SITUATION

Water leaks into the right rear luggage compartment area and can damage any control modules located there (for example Park Distance Control PDC). Various Check Control Messages may also be displayed.

CAUSE

Water leaks through the seal in fuel filler cover bowl area.

PROCEDURE

	<p>Perform a water leak test the area of the fuel filler flap and cover bowl. If traces of water are found the right rear trunk area, replace the cover bowl.</p> <p>Refer to ISTA repair instructions “ 41 63 003 Replace cover bowl” Note: When replacing the cover bowl make sure, that the sealing surface of the body is clean and dry. Put a thin layer of a silicone sealer between the body and cover bowl seal before assembly</p>
--	--

Part Number	Description	Quantity
41 00 2 990 139	Cover pot	1

WARRANTY INFORMATION

Defect Code:	41 63 00 41 00	
Labor Operation:	Labor Allowance:	Description:
41 63 004	Refer to KSD	Removing and installing or replacing cover

And, as necessary:		
41 99 000	Work time (WT)	Work time to perform a water leak test the area of the fuel filler flap and cover bowl

If you are using a Main labor code for another repair, use the Plus code labor operation 41 63 504 instead.

Refer to KSD2 for the corresponding flat rate unit (FRU) allowance

Work time labor operation code 41 99 000 is not considered a Main labor operation; however, it does require an individual punch time and an explanation on the repair order and in the claim comments section.

[Copyright ©2015 BMW of North America, Inc.]