



SUBJECT

Delivery Stop: Retrofit Repair Satellite Radio (Option Code SA655)

MODEL

F22 (2 Series Coupe)

Produced From July 1, 2015 to August 26, 2015

SITUATION

A Delivery Stop has been issued on F22 vehicles. These vehicles have an inoperative SiriusXM® satellite radio.

Affected vehicles in dealer inventory must not be retailed or delivered until this issue is corrected. Vehicles at ports of entry will be repaired prior to dealer delivery.

CAUSE

The affected vehicles were produced with Satellite Radio Prep (option code SA693) instead of Satellite Radio (option code SA655).

AFFECTED VEHICLES

Vehicles requiring the retrofit will display the following “Vehicle Comment” In the DCSnet “Warranty Vehicle Inquiry:

Delivery Stop: SiriusXM satellite radio retrofit repair (option code SA655) applies to this vehicle, please see SI B65 15 15. If this vehicle already had the retrofit repair performed, no further action is required.

Important note: Affected vehicles that are still at their port of entry will have the retrofit repair performed prior to their delivery to your center.

PROCEDURE

1. Order a VIN-specific enable code REPAIR kit in ASAP. The Satellite Radio enable code 006F0001 should already be in the “repair kit,” please do not order a “Retrofit” enable code.
2. For an explanation of BMW Enabling Codes and an availability list for all BMW vehicles, please see [SI B09 04 09](#). Also refer to [SI B09 05 09](#) see both **SI**'s so as not to order the Repair Enabling codes.
3. Save the enable codes to a USB stick. Insert the USB stick into the ISSS NEXT and begin an ISTA/P session.
4. Select CONVERSIONs
 - o Select RETROFIT, SATELLITE TUNER

5. Follow measure plan recommendations.
6. After programming/coding please allow the vehicle to enter sleep mode before testing. To check Satellite radio's operation, take vehicle outdoors with a clear line of sight to the sky.

WARRANTY INFORMATION

Reimbursement for this retrofit repair will be via normal claim entry utilizing the following information:

Defect Code:	85 10 02 79 BV	Satellite Radio Retrofit Repair
Labor Operation:	Labor Allowance:	Description:
00 00 006	Refer to KSD2	Performing "vehicle test" (with vehicle diagnosis system – checking faults)
And:		
61 21 528	Refer to KSD2	Connect an approved battery charger/power supply(indicated in KSD2 as "Charging battery")
And:		
61 00 730	Refer to KSD2	Programming / encoding control unit(s)

If you are using a Main labor code for another repair, use the Plus code labor operation 00 00 556 instead.

Refer to KSD2 for the corresponding flat rate unit (FRU) allowances.

Vehicle Programming and Coding

If a control module was working properly and it fails to program correctly or requires initialization, please claim this additional work with the applicable KSD2 labor operations under the defect code listed above.

The diagnosis and repair of vehicles "arriving" with failed control modules or stored faults which will cause them to fail during programming cannot be claimed under the defect code listed in this bulletin.

Other Repairs

If other eligible and covered work is performed "prior" to programming and coding the vehicle, claim this work with the applicable defect code and labor operations listed in KSD2.

ATTACHMENTS

View PDF attachment [B651515_DS_Legal](#).