



SI M64 01 15
Heating and Air-conditioning

September 2015
Technical Service

SUBJECT

Air Draft into Driver's Foot-well

MODEL

F56 (Cooper, Cooper S 2 door hardtop)

Produced from November 30, 2013 to January 28, 2014

SITUATION

With the blower motor on, a draft in to the driver's foot-well area can be felt.

CAUSE



As shown in the picture, the plug is missing from the air conditioning housing near the driver's foot-well area.


The missing plug may be found in the vehicle **DO NOT** reinstall since it fits too loose and may fall out again.

CORRECTION

Replace with a new plug.

PROCEDURE

1. In the driver's foot-well area, locate the area where the plug should be installed.
2. The close up picture shows the exact location of the plug.

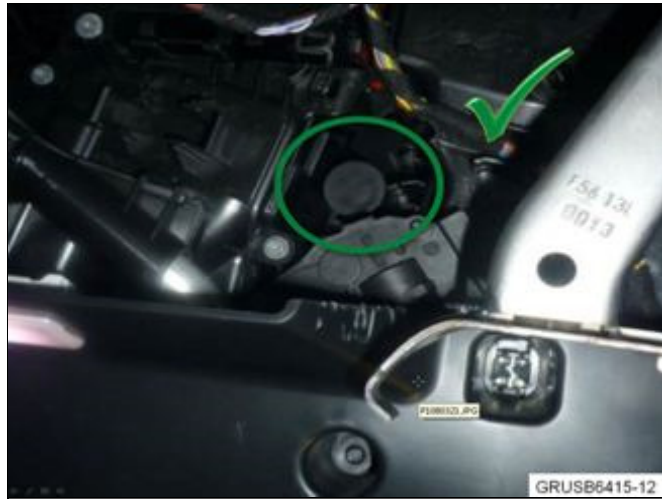

3. Install a new plug.



- The new plug is shown installed.

PARTS INFORMATION

Part Number	Description	Quantity
51 71 8 257 286	Seal plug for air conditioning housing	1

WARRANTY INFORMATION

Covered under the terms of the MINI New Passenger Car Limited Warranty.

Defect Code:	64 11 00 48 00	
Labor Operation:	Labor Allowance:	Description:
64 99 000	4 FRU	Work time to perform the repair procedure (Main work)

Or:		
64 99 000	2 FRU	Work time to perform the repair procedure (Plus work - Vehicle already in the workshop)

[Copyright ©2015 BMW of North America, Inc.]