



---

This Service Information bulletin supersedes SI B12 10 15 **dated January 2015.**

**NEW** designates changes to this revision

#### **SUBJECT**

**N63: CBS Oil Service Conversion in ISTA/P**

#### **MODEL**

F01 (7 Series Sedan)

F02 (7 Series Sedan LWB)

Produced to approximately 9/2009

F04 (ActiveHybrid 7)

Produced to approximately 3/2012

F10 (5 Series Sedan)

Produced to approximately 9/2010

E70 (X5)

E71 (X6)

E72 (ActiveHybrid X6)

Produced to 10/2010

All with the N63 engine

#### **SITUATION**

**NEW** The CBS oil service conversion performed for the **N63 Customer Car Package** and timing chain check ([SI B11 16 14](#)) did not work correctly with ISTA/P 3.54.x or 3.55.0.

**NEW** It did not change the interval to the desired 12 months/10,000 miles for the vehicles listed above in the specified production ranges.

The “Conversion, oil service 12 months/15,000 km/10,000 miles” is working properly for all other N63 vehicles produced after these dates.

#### **NEW CAUSE**

Incorrect coding data in the affected ISTA/P versions

#### **NEW CORRECTION**

The conversions are now corrected with ISTA/P 3.55.1.

Please install this version to perform the conversion on all N63 CCP repairs.

This information will be updated once details are provided for addressing those customers who previously had the N63 CCP repairs performed, but the conversion procedure was unsuccessful.

Target integration levels for the affected models within the production dates listed above:

F01, F02, F04	Target integration: F001-15-03-502
F10	Target integration: F010-15-03-502
E70, E71, E72	Target integration: E070-14-11 501

**WARRANTY INFORMATION**

Not applicable.

[ Copyright ©2015 BMW of North America, Inc. ]