

June 2015 Technical Service

This Service Information bulletin supersedes SI B13 05 12 dated November 2012.

NEW designates changes to this revision

SUBJECT

N20 Engine: Ticking Noise from High-pressure Fuel Pump

MODEL

F30 (3 Series Sedan)

NEW Produced from 1/2012 to 6/2012

SITUATION

The customer complains of a high-frequency ticking noise from the engine compartment. The noise can be heard inside and outside the vehicle.

CAUSE

Mechanical vibrations inside the high-pressure fuel pump

CORRECTION

Install high-pressure fuel pump acoustic cover P/N 13 51 7 629 169. The plastic acoustic cover will snap onto the high-pressure fuel pump.

Do not remove the fuel lines or the high-pressure fuel pump to install the acoustic cover.

PARTS INFORMATION

Part Number	Description	Quantity
13 51 7 629 169	Acoustic cover, high-pressure fuel pump	1

WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty.

Defect Code:	13 51 67 37 00	
Labor Operation:	Labor Allowance:	Description:
13 99 000	3 FRU	Work time for installing acoustic cover for high-pressure fuel pump (Main work)
Or:		
13 99 000	1 FRU	Work time for installing acoustic cover for high-pressure fuel pump (Plus work – Vehicle is already in the workshop)

[Copyright ©2015 BMW of North America, Inc.]