

**Measure no.**

US 61326053-01

**Subject**

Turn signals remain on after alarm is activated.

**Status date (mm/dd/yy)**

5/8/15

**Status**

Accepted

**Organization**

US, MOT

**Date created (mm/dd/yy)**

5/8/15

**Created by**

Markus Grosam

**PQM Problem reference****Release date (mm/dd/yy)****Approved by****Dealer release**

Allow automatic release

**Vehicles affected****E series**

K48 K50 K51 K52 K53

**Engine**

K54

**Body****Production period (from/to)**

(mm/dd/yy)

**Comment on production period**

/

**Feedback (all cases relating to****measure up to) (mm/dd/yy)****Complaint**

After activation of the alarm system, the turn indicators remain on for 1 minute.

Previously they turned off automatically.

**Cause**

Software malfunction with integration level K001-14-08-510

**Measure**

With ISTA/P V55.0 or higher, update to integration level K001-15-03-510 or

a more recent version.

**Complaint**

<b>Fault location</b>	<b>Fault type</b>	<b>Fault place</b>	<b>Fault conditions</b>
Display: Alarm system	Failure		Sporadic
Flashing	Lights up too bright / glares	Both sides / all	Sporadic

**Cause**

#	Fault location	Fault type	Fault place
1	61/35 Alarm system control unit	Software error	
Repair Task	Special Clearance	Area	
Program/encode	No	Electrics/Electronics	

---

**Fault code**

---

**Progman / DIS / ISTA / ISTA/P**

System	State	Version
--------	-------	---------

---