



This Service Information bulletin supersedes SI 34 06 15 **dated July 2015**.

**NEW** designates changes to this revision

#### SUBJECT

### Grinding Noise from Rear Brakes

#### MODEL

F80 (M3 Sedan)

F82 (M4 Coupe)

F83 (M4 Convertible)

**NEW** Produced from start of production to 05/14/2015

**NEW** With the standard compound brakes or optional Carbon Ceramic (2NK)

#### SITUATION


Pebbles, road grit, or other foreign materials caught between the brake protection plate and the brake disc may cause a disturbing noise in the rear axle area.

#### PROCEDURE

Check the brake protection plates on the rear axle for damage between the protection plate and brake disc.



If there is visible damage on the brake protection plate, replace both rear axle protection plates with the improved part per REP 34 21 280.

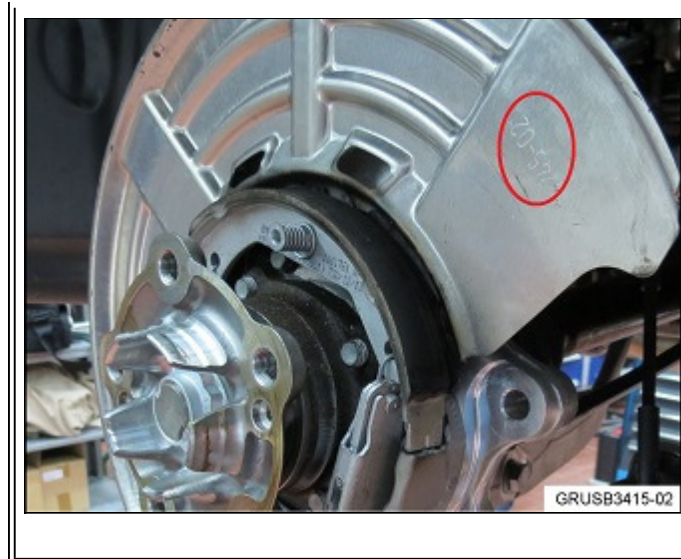

The improved protection plate can be identified by the index “03” stamped after the P/N.  
The old version has an index “02,” as shown in the photo.

#### PARTS INFORMATION

Part Number	Description	Quantity
34 21 2 284 745	Protection plate	2

#### WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks.

<b>Defect Code:</b>	<b>34 21 03 39 00</b>	
<b>Labor Operation:</b>	<b>Labor Allowance:</b>	<b>Description:</b>
<b>NEW</b> 34 21 284	Refer to KSD2	Removing and installing or replacing both rear protective plates

If you are using a Main labor code for another repair, use the Plus code labor operation 34 21 784 instead, or if the rear wheels are already removed, use 34 21 785.

[ Copyright ©2015 BMW of North America, Inc. ]