



---

This Service Information bulletin supersedes SI B66 06 15 **dated September 2015.**

**NEW** designates changes to this revision

#### **SUBJECT**

### **Sporadic Check Control Messages of the Driver Assistance System**

#### **MODEL**

F32 (4 Series Coupe)

F36 (4 Series Gran Coupe)

**NEW** F48 (X1)

F82 (M4 Coupe)

Produced from July 9, 2015 to August 12, 2015

With option 5AS – Active Driving Assistant

And / Or

8TH – Speed Limit Info

#### **SITUATION**

Sporadically, a CCM (Check Control Message) is displayed advising that the Camera-based Driver Assistant system has failed. This is due to the vehicle interior reaching very high temperatures.

During this failure, all KAFAS (Camera-based driver assistance systems) system functionalities are inoperative.

The affected functionalities are:

- Pedestrian Detection
- Front Collision Warning
- Lane Departure Warning
- Speed Limit Info (if equipped)

The following fault code is stored in the KAFAS control unit:

- 0x800AC0 – Switching off due to excess temperature

Note: The system is functional after the interior temperature has cooled down or by cycling the ignition off and on again.

### CAUSE

Incorrect calibration of the temperature sensor in the KAFAS camera.

### NEW CORRECTION

Install a KAFAS camera with:


- A date code of 153214 and higher
- OR
- Identified by 3 white dots


### PROCEDURE

1. Perform a vehicle diagnostic using the latest ISTA version

Always connect a BMW approved battery charger/power supply ([SI B04 23 10](#))

2. Is fault code **0x800AC0** stored?
  - No – Continue standard diagnosis
  - Yes – check the KAFAS camera date code

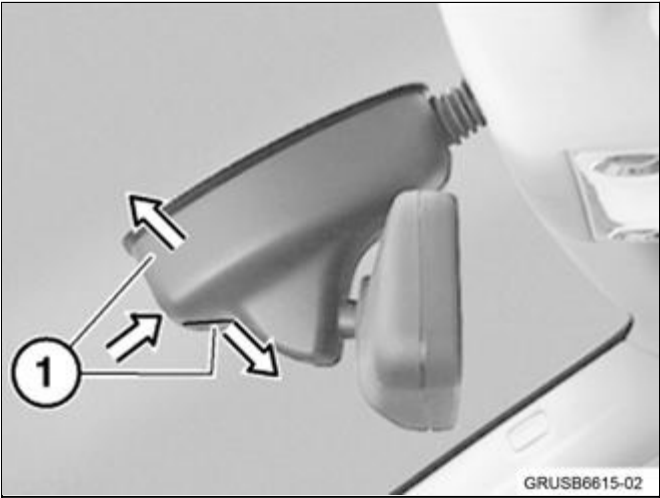	<p><b>Note: Latch mechanisms of two-part mirror base cover (1) must not be damaged.</b></p> <p>Remove the two-part mirror base cover (1) by pressing from below and separating.</p> <p>Slide out two-part mirror base cover (1) and remove.</p>
	<p>The date code label is shown on the</p>

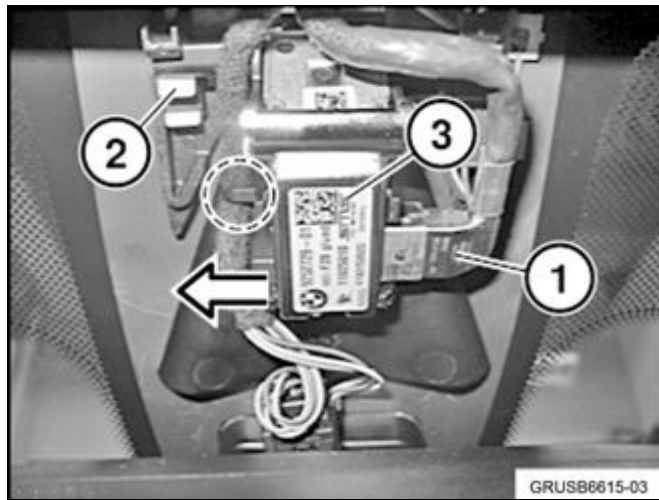

bottom of the KAFAS camera (3).



**NEW** Note: The picture is for illustration purposes only.

- The affected units will have a date code of 152701 to 153213.
- The date code is highlighted by the green arrow and box.
- The updated part will have a date code of 153214 or higher



- **NEW** Note: Some updated parts may not have a date code of 153214 or higher. Rather, they will have 3 white dots, as shown.

3. **NEW** Replace the KAFAS camera if the date code range from 152701 to 153213.
4. Refer to Repair Instructions REP 66 51 030 – remove and install/replace KAFAS camera

**WARRANTY INFORMATION**

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks or the BMW Certified Pre-Owned Program.

**Fault Code “0x800AC0” is stored and the KAFAS camera has a “date code” of 1527 to 1532**

<b>Defect Code:</b>	<b>66 51 02 15 00</b>	
<b>Labor Operation:</b>	<b>Labor Allowance:</b>	<b>Description:</b>
00 00 006	Refer to KSD2	Performing “vehicle test” (with vehicle diagnosis system – checking faults)
And:		
61 21 528	Refer to KSD2	Connect an approved battery charger/power supply(indicated in KSD2 as “Charging battery”)
And:		
66 51 531	Refer to KSD2	Replace KAFAS camera (after vehicle diagnosis)

If you are using a Main labor code for another repair, use the Plus code labor operation 00 00 556 instead.

Refer to KSD2 for the corresponding flat rate unit (FRU) allowances.

**Other Repairs**

If other eligible and covered work is performed as a result of performing the ISTA diagnostics and related test plans results, claim this work with the applicable defect code and labor operations listed in KSD2.

[ Copyright ©2015 BMW of North America, Inc. ]