



SI M62 01 15
Instruments

October 2015
Technical Service

This Service Information bulletin supersedes SI M62 01 15 **dated July 2015**.

NEW designates changes to this revision

SUBJECT

Door Open Message Displayed, Even Though Door Is Closed

MODEL

R60 (Cooper Countryman, Cooper S Countryman, JCW Countryman)

R61 (Cooper Paceman, Cooper S Paceman, JCW Paceman)

NEW Produced from November 2010 to March 2015

NEW SITUATION

While driving, a CCM (Check Control Message) indicates the doors are open, even though they are closed. Also, sometimes the gong will sound and the interior lights will go on and off.

NEW CAUSE

The FRM (Footwell Module) sees an incorrect door lock status caused by voltage variations in the door locks.

NEW CORRECTION

Install lock repair kit in each door

NEW PROCEDURE

Follow attached procedure

NEW PARTS INFORMATION

Part Number	Description	Quantity
61 12 7 354 886	Repair Set Lock	As Needed

NEW WARRANTY INFORMATION

Covered under the terms of the MINI New Passenger Car Limited Warranty or the MINI NEXT Certified Pre-Owned Limited Warranty.

Defect Code:	61 38 06 14 00	
Labor Operation:	Labor Allowance:	Description:
00 00 006	Refer to KSD2	Performing "vehicle test" (with vehicle diagnosis system – checking faults)

And:		
61 21 528	Refer to KSD2	Connect an approved battery charger/power supply (indicated in KSD2 as “Charging battery”)

If you are using a Main labor code for another repair, use the Plus code labor operation 00 00 556 instead.

And, as necessary:

Labor Operation:	Labor Allowance:	Description:
51 41 505	Refer to KSD2	Removing and installing both front door trim panels
And:		
51 42 505	Refer to KSD2	Removing and installing both rear door trim panels
And:		
67 00 009	1 FRU	Inspecting date code on each
And:		
51 99 000	Work time (WT)	Installation of the door lock repair kit (s): Two Doors = 2 FRU. And as applicable: Four Doors = 4 FRU.

Refer to KSD2 for the corresponding flat rate unit (FRU) allowances.

Work time labor operation code 67 00 009 and 51 99 000 are not considered a Main labor operations. Also, since the “work time” FRU allowances to be claimed are specified, a separate punch time is not required.

Overlapping Labor – Associated and/or Other Repairs

If invoicing KSD2 flat rate labor operation codes for the additional repair work results in overlapping labor being claimed, invoice work time labor operation 00 50 000 for the additional time (FRU) minus the overlap instead.

On the repair order and in the claim comment section, please identify the labor operations that labor operation code 00 50 000 replaces and itemize the claimed FRU amount.

Work time labor operation code 00 50 000 is not considered a Main labor operation.

Associated Repairs: When work time labor operation 00 50 000 is used as an extension of the repair outlined in this bulletin, a separate defect code and punch time(s) are not required.

Other Repairs: When work time labor operation 00 50 000 is used for work that will be claimed under different defect codes, separate punch time(s) are required.

ATTACHMENTS

View PDF attachment [M620115 Attachment](#).

[Copyright ©2015 BMW of North America, Inc.]