

Measure no.

US 62336252-01

Subject

Retaining tabs on the side trim panel break.

Status date (mm/dd/yy)

12/1/15

Status

Accepted

Organization

US, MOT

Date created (mm/dd/yy)

12/1/15

Created by

Christine Koehling

PQM Problem reference**Release date (mm/dd/yy)****Approved by****Dealer release**

Allow automatic release

Vehicles affected**E series**

K46/12

Engine**Body****Production period (from/to)**

(mm/dd/yy)

Comment on production period

/

Feedback (all cases relating to**measure up to) (mm/dd/yy)**

Complaint

Side trim panel loose

Cause

Self-locking expansion nuts transmit an excessively high torque (5 Nm) while being screwed in, which the plastic cannot withstand.

See attached images.

Measure

Effective immediately, trim panel collar bolts M5 x 14.5 mm are to be tightened to 2 Nm instead of the previous 5 Nm.

Complaint**Fault location**

46/63 Trim panel. front,
side

Fault type

Part connection: Tight fit,
not OK

Fault place

Both sides / all

Cause

#	Fault location	Fault type	Fault place
1	46/63 Trim panel, side section		Left
Repair Task	Special Clearance	Area	
Other tasks	No	Body and Trim	

Fault code

Progman / DIS / ISTA / ISTA/P

System	State	Version
--------	-------	---------

© 2002-2015 BMW OF NORTH AMERICA, LLC. ALL RIGHTS RESERVED.





