



This Service Information bulletin supersedes SI 26 01 15 **dated November 2015**.

Please perform the procedure outlined in this Service Information on all affected vehicles before customer delivery. In the event the customer has already taken delivery of the vehicle, please perform the procedure the next time the vehicle is in the shop.

SUBJECT

Service Action: Replace the NVLD Temperature Sensor

MODEL

F06 (6 Series Gran Coupe)

F10 (5 Series Sedan)

F12 (6 Series Convertible)

F13 (6 Series Coupe)

G12 (7 Series Sedan new)

NEW SITUATION

The wrong temperature sensor for the Natural Vacuum Leak Detection (NVLD) may have been installed.

NEW AFFECTED VEHICLES

This Service Action involves certain F06, F10, F12, F13 and G12 models produced from November 3, 2015 to November 5, 2015.

Vehicles which require this Service Action to be completed will show it as "Open" when checked either in the "Service Menu" of DCSnet (Dealer Communication System) or with the Key Reader.

NEW PROCEDURE

Access the temperature sensor for the NVLD following repair instruction RA 16 13 522 Removing and installing/replacing temperature sensor for Natural Vacuum Leak Detection (NVLD).

	<p>If the temperature sensor is labeled "PORSCHE" (1), it needs to be replaced.</p>
--	---

**NEW PARTS INFORMATION**

Part Number	Description	Quantity
16 13 7 333 588	NVLD temperature sensor	1

NEW WARRANTY INFORMATION

Reimbursement for this Service Action will be via normal claim entry utilizing the following information:

Defect Code:	00 16 05 02 00	
Labor Operation:	Labor Allowance:	Description:
00 63 927	3 FRU	Check the NVLD temp sensor (No replacement needed, no further action needed) (Plus work)
Or:		
00 63 928	3 FRU	Check and replace the NVLD temp sensor (Plus work)

ATTACHMENTS

View PDF attachment [B160915 Delivery Stop Legal](#).

[Copyright ©2015 BMW of North America, Inc.]