



NUMBER: 08-078-15

GROUP: Electrical

DATE: August 04, 2015

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.

THIS SERVICE BULLETIN IS ALSO BEING RELEASED AS RAPID RESPONSE TRANSMITTAL (RRT) 15-081. ALL APPLICABLE SOLD AND UN-SOLD RRT VIN'S HAVE BEEN LOADED. TO VERIFY THAT THIS RRT SERVICE ACTION IS APPLICABLE TO THE VEHICLE, USE VIP OR PERFORM A VIN SEARCH IN TECHCONNECT. ALL REPAIRS ARE REIMBURSABLE WITHIN THE PROVISIONS OF WARRANTY.

SUBJECT:

Antenna Mast Will Not Screw Into Base

OVERVIEW:

This bulletin involves inspecting and installing the correct antenna mast, if required.

MODELS:

2016	(FB)	Fiat 500X
2015	(BU)	Jeep Renegade

NOTE: This bulletin applies to vehicles within the following markets/countries: U.S. and Canada Markets Only.

NOTE: This bulletin applies to vehicles built on or after April 12, 2015 (MDH 0412XX) and on or before June 12, 2015 (MDH 0612XX) equipped with UConnect 5.0 AM/FM/BT (Sales Codes RA2).

SYMPTOM/CONDITION:

The dealer may not be able to install the antenna mast to the antenna base. The mast may have the incorrect thread pitch (1.0 mm) and will not screw into the base. The mast should have a thread pitch of 0.8 mm.

DIAGNOSIS:

If a customer's VIN is listed in VIP or your RRT VIN list, perform the repair.

PARTS REQUIRED:

Qty.	Part No.	Description
1	68276864AA	Mast, Antenna

REPAIR PROCEDURE:

CAUTION: Do NOT force the antenna mast into the base, hand tighten only.

1. Using the antenna mast that came with the vehicle, try and screw the mast into the base.
2. If the correct mast is used, it will easily screw into the base. Did the mast easily screw into the base?
 - a. Yes >>> This bulletin has been completed, use inspect LOP only (08-60-05-95) to close the active RRT.
 - b. No >>> Replace the mast with the part number listed above.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Skill Category	Amount
08-60-05-95	Antenna, Mast - Replace and/or Inspect (0 - Introduction)	6 - Electrical and Body Systems	0.0 Hrs.

Related			
95-08-61-90	Antenna, Mast - Replace Only.	6 - Electrical and Body Systems	\$5.00

NOTE: Use both LOPs, ONLY if the antenna needed to be replaced.

FAILURE CODE:

ZZ	Service Action
----	----------------