

GPOP - Issue Review System

Part Number: 68070702A\$, 68142340A\$, 68070689A\$

Part Description: O2 Sensor

Issue Description: If your dealership is located within 1-2 hours of Metro Detroit, please contact Nadeem Akhtar at cell (734) 417-7332 before replacing this part, as engineering would like to evaluate vehicles with this issue.~
If no response is received within 15 minutes, then continue with repair.~
In all other cases, before replacing this part due to a P0141 fault code, please perform the normal diagnostic routine for this Diagnostic Trouble Code.~
If there is no trouble found, and the fault is stored, DO NOT replace the O2 Sensor, instead, perform the following procedure:~

1. Clear the P0141 fault.~
2. Soak the car for over 6 hours.~
3. Turn the key to the "on" position for 3 seconds (Do NOT crank the engine).~
4. Turn the key directly to "crank".~
5. Test drive the vehicle for two separate 6-minute drive cycles with a "key-off" in between drive cycles.~

~
Contact Us at CAGRIS@Chrysler.com for feedback related ONLY to this GPOP Tech Tip. DO NOT email regarding repair procedures unrelated to this Tech Tip or part order inquires. Please include the Part Number (s) and Tech Tip Part Description of the Tech Tip you are referencing for our tracking system.~
