

GPOP - Issue Review System

Part Number: 68295438A\$, 68253984A\$, 68212738A\$, 68253983A\$, 68210095A\$, 68039104A\$, 68240477A\$, 68245792A\$, 68212739A\$, 68210648A\$

Part Description: Turbocharger, Turbo Speed Sensor, Turbo Gaskets and Seals

Issue Description: 1. Do Not Replace Turbocharger for Exhaust Brake Operation Complaints.~
Do not replace the turbocharger for complaints of exhaust brake operating when the Exhaust Brake switch is off. Replacing the turbocharger will not address these complaints. Update the PCM with the new software version to correct this issue.~

2. Turbo Speed Sensor is Now Serviceable.~

If a Turbocharger Speed Sensor is being replaced for a P2580 or any other reason, do not replace the entire Turbocharger Kit. The Turbo Speed Sensor is a serviceable part on the turbo and is available separately. For 2013-2015 Chassis Cab or Pickup order PN 68210095A\$. For 2007-2012 Chassis Cab or Pickup, order PN 68039104A\$.~

3. Replace Exhaust Gaskets with Turbocharger Removal.~

Anytime the turbocharger is removed/replaced, the turbocharger gasket, turbocharger outlet seal, and turbocharger band clamp must be replaced. In addition, if the front exhaust pipe is removed/replaced, the turbocharger outlet seal and band clamp must also be replaced. Do not reuse these parts.

~ _____ ~

Contact Us at CAGRIS@Chrysler.com for feedback related ONLY to this GPOP Tech Tip. DO NOT email regarding repair procedures unrelated to this Tech Tip or part order inquiries. Please include the Part Number (s) and Tech Tip Part Description of the Tech Tip you are referencing for our tracking system.
