

Field campaign

Topic	Incorrect fuel filler door and bowl assembly (SC15/14)				
Market area	United Kingdom E01 Bentley UK (6E01),Germany E02 Bentley rest Europe (6E02),United States E05 Bentley USA and rest America (6E05),United Arab Emirates E06 Bentley Middle East and Africa (6E06)				
Brand	Bentley				
Transaction No.	2041860/1				
Campaign number	EA35				
Note					
Type	Service Campaign				
US code					

Vehicle data

Continental GTC

Sales types

Type	MY	Brand	Designation	Engine code	Gearbox code	Final drive code
394*	2016	E		*	*	*

Chassis numbers

Manufacturer	Filler	Type	Filler	MY	Factory	From	To	Prod from	Prod to
SCB	GN2	3W	3	G	C	053198	053198		
SCB	GF2	3W	1	G	C	053200	053200		
SCB	GU3	ZA	1	G	C	053205	053205		
SCB	GT3	ZA	0	G	C	053215	053215		
SCB	GN2	ZA	0	G	C	053221	053221		
SCB	GE2	3W	6	G	C	053227	053227		
SCB	GE2	3W	X	G	C	053229	053229		
SCB	GE2	3W	7	G	C	053236	053236		
SCB	GE2	3W	4	G	C	053243	053243		
SCB	GN2	3W	8	G	C	053245	053245		
SCB	GE2	3W	6	G	C	053258	053258		
SCB	GE2	3W	6	G	C	053261	053261		
SCB	GH3	ZA	0	G	C	053264	053264		
SCB	GT3	ZA	8	G	C	053270	053270		
SCB	GK2	3W	2	G	C	053279	053279		
SCB	GH3	ZA	3	G	C	053288	053288		
SCB	GH3	ZA	3	G	C	053291	053291		
SCB	GE2	3W	8	G	C	053293	053293		
SCB	GH3	ZA	6	G	C	053298	053298		
SCB	GE2	ZA	2	G	C	053303	053303		
SCB	GT3	ZA	7	G	C	053308	053308		
SCB	GE2	3W	7	G	C	053317	053317		
SCB	GJ3	ZA	4	G	C	053319	053319		
SCB	GF2	3W	5	G	C	053328	053328		
SCB	GU3	ZA	1	G	C	053334	053334		
SCB	GE2	3W	9	G	C	053335	053335		
SCB	GH3	ZA	1	G	C	053337	053337		
SCB	GN2	3W	8	G	C	053343	053343		
SCB	GH3	ZA	6	G	C	053348	053348		

Documents

Document name
master.xml

Notes

■ Repair instructions

Technical background

For 16MY the method of storing the fuel filler cap during refuel has changed. A small number of 16MY Continental GT Convertible cars have the incorrect fuel filler bowl assembly fitted

Remedy



Figure 1



Figure 2

Fit the correct fuel filler flap and bowl assembly (part number 3W7809857K). Figure 1 shows the correct 16MY fuel filler flap and bowl assembly. Figure 2 shows the incorrect assembly for 16MY

Reference workshop manual, Rep. Gr.55 Fuel Filler Flap and Bowl – To Remove and Fit

Customer notification

Customers do not need to be informed directly of this campaign. Please ensure that all affected vehicles are checked and repaired during a service visit. You should also inform your new and used cars sales departments so that the vehicles affected can be checked and, if necessary, repaired immediately (and not just before sale)

Warranty accounting instructions

Warranty Type 790 or 710

Labour Operation Code 55375500

Damage Service Number EA35

Damage Code 00 66
Criteria I D 01
Time 60 TU

Genuine parts

The required replacement parts should be ordered from Bentley Motors Limited Crewe or through your regional Bentley parts distribution centre

Parts supply

Description	Part number	Quantity
Bowl	3W7809857K	1
Fuel door Label	3W0010???? *	1

*Select correct fuel door label part number using VIN specific search in ETKA.

Parts despatch control

.

Repair instructions

■ Notes

Technical background

For 16MY the method of storing the fuel filler cap during refuel has changed. A small number of 16MY Continental GT Convertible cars have the incorrect fuel filler bowl assembly fitted

Check

If the vehicle is not already listed as repaired in the "Repair History" (in ElsaPro), check for the presence of the correct fuel filler bowl assembly (see Figure 1)

Genuine parts

The required replacement parts should be ordered from Bentley Motors Limited Crewe or through your regional Bentley parts distribution centre

Work

Fit the correct fuel filler flap and bowl assembly (part number 3W7809857K)

Reference workshop manual, Rep.Gr.55 Fuel Filler Flap and Bowl – To Remove and Fit

Fit the correct new label to the fuel filler flap and bowl assembly, use FIVIN search in ETKA for the correct label part number

Identification

The presence of the correct fuel filler bowl assembly will serve to identify this campaign has been completed

■ Repair instructions ■ Notes