Field campaign

Topic	Incorrect fuel filler door and bowl assembly (SC15/11)				
Market area	United Kingdom E01 Bentley UK (6E01), Germany E02 Bentley rest Europe (6E02), United States E05 Bentley USA and rest America (6E05)				
Brand	Bentley				
Transaction No.	2041153/1				
Campaign number	EA32				
Note					
Туре					
US code					

Vehicle data

Continental GT

Sales types

Type	MY	Brand	Designation	Engine code	Gearbox code	Final drive code	
393*	2016	E		*	*	*	

Chassis numbers

Manufacturer	Filler	Туре	Filler	MY	Factory	From	То	Prod from	Prod to
SCB	FN6	3W	5	G	С	051519	051519		
SCB	FJ7	ZA	0	G	С	051523	051523		
SCB	FU7	ZA	0	G	С	051528	051528		
SCB	FF6	3W	Χ	G	С	051531	051531		
SCB	FU7	ZA	2	G	С	051532	051532		
SCB	FJ7	ZA	4	G	С	051539	051539		
SCB	FF6	3W	6	G	С	051543	051543		
SCB	FE6	3W	9	G	С	051555	051555		
SCB	FF6	3W	9	G	С	051567	051567		
SCB	FF6	3W	6	G	С	051588	051588		
SCB	FF6	3W	5	G	С	051596	051596		
SCB	FU7	ZA	9	G	С	051611	051611		·
SCB	FE6	3W	Χ	G	С	051614	051614		

Documents

Document name master.xml Notes . Repair instructions

Technical background

For 16MY the method of storing the fuel filler cap during refuel has changed. A small number of 16MY Continental GT cars have the incorrect fuel filler bowl assembly fitted

Remedy



Figure 1



Figure 2

Fit the correct fuel filler flap and bowl assembly (part number 3W8809857M). Figure 1 shows the correct 16MY fuel filler flap and bowl assembly Figure 2 shows the incorrect assembly for 16MY Reference workshop manual, Rep. Gr.55 Fuel Filler Flap and Bowl – To Remove and Fit

Customer notification

Customers do not need to be informed directly of this campaign. Please ensure that <u>all</u> affected vehicles are checked and repaired during a service visit. You should also inform your new and used car sales departments so that the vehicles affected can be checked and, if necessary, repaired immediately (and not just before sale)

Warranty accounting instructions

Warranty Type 790 or 710 Labour Operation Code 55 37 55 99

Damage Service Number EA32
Damage Code 00 66
Criteria ID 01
Time 60TU

Genuine parts

The required replacement parts should be ordered from Bentley Motors Limited Crewe or through your regional Bentley parts distribution centre

Parts supply

Description	Part number	Quantity	
Bowl	3W8809857M	1	
Fuel door Label	3W0010012? *	1	

^{*}VIN specific fuel door label part number list is as follows.

VIN	Description	Fuel door label part number
4114	Description	r dei door label part ildilibel
SCBFN63W5GC051519	New Continental GT V8	3W0 010 012 E
SCBFJ7ZA0GC051523	New Continental GT Speed	3W0 010 012 G
SCBFU7ZA0GC051528	New Continental GT	3W0 010 012 G
SCBFF63WXGC051531	New Continental GT Speed	3W0 010 012 E
SCBFU7ZA2GC051532	New Continental GT	3W0 010 012 G
SCBFJ7ZA4GC051539	New Continental GT Speed	3W0 010 012 G
SCBFF63W6GC051543	New Continental GT Speed	3W0 010 012 E
SCBFE63W9GC051555	New Continental GT V8 S	3W0 010 012 E
SCBFF63W9GC051567	New Continental GT Speed	3W0 010 012 E
SCBFF63W6GC051588	New Continental GT Speed	3W0 010 012 E
SCBFF63W5GC051596	New Continental GT Speed	3W0 010 012 E
SCBFU7ZA9GC051611	New Continental GT	3W0 010 012 G
SCBFE63WXGC051614	New Continental GT V8 S	3W0 010 012 E

Parts despatch control

Repair instructions

. Notes

Technical background

For 16MY the method of storing the fuel filler cap during refuel has changed. A small number of 16MY Continental GT cars have the incorrect fuel filler bowl assembly fitted

Check

If the vehicle is not already listed as repaired in the "Repair History" (in ElsaPro), check for the presence of the correct fuel filler bowl assembly (see Figure 1)

Genuine parts

The required replacement parts should be ordered from Bentley Motors Limited Crewe or through your regional Bentley parts distribution centre

Work

Fit the correct fuel filler flap and bowl assembly (part number 3W8809857M) Reference

workshop manual, Rep. Gr.55 Fuel Filler Flap and Bowl - To Remove and Fit

Fit the correct new label to the fuel filler flap and bowl assembly, use FI VIN search for the correct label part number

Identification

The presence of the correct fuel filler bowl assembly will serve to identify this campaign has been completed