



Team Tips

ARTICLE: **I-15-05-01**DATE: **05/06/2015***Published for Indian Motorcycle Dealerships, Distributors, and Service Technicians*

2015 Indian Scout – Tail Lamp Wire Harness Routing

This Team Tip has been released to communicate the importance of correct tail lamp wire harness routing and connector retention when servicing the fender or license plate bracket.

Indian Motorcycles has determined there is a potential for the rear tire to contact the tail lamp wire harness if the harness is not routed and retained correctly during reassembly. As part of tail lamp, rear turn signals, license plate bracket or fender service, verify the tail lamp wire harness is retained with two panduit straps (1) as illustrated below. Also, the tail lamp connector (2) should be secured with a push in dart and oriented as illustrated below.

Additional electrical system and service information can be found in the 2015 Indian Motorcycle Scout Service Manual (PN: 9925346).

Please distribute this Team Tip to all dealership personnel.

