



SERVICE CAMPAIGN BULLETIN

TITLE:	Instrument Cluster Coding String Update
CAPPAIGN REFERENCE	03E
DOCUMENT NUMBER:	11 M 088
AFFECTED VEHICLES:	McLaren 650S Le Mans
SITUATION:	Engineering at McLaren Automotive have released a new Instrument Cluster (IC) coding string which removes the option to set the Intake Sounder Generator (ISG) as this is not installed on a McLaren 650S Le Mans.
PROCEDURE:	Please follow the procedure outlined in this document below.


1. Connect the McLaren Diagnostic System (MDS) to the vehicle.
2. Select IC_04 (1), then Coding (2), then select Write coding string (3) followed by OK (4).

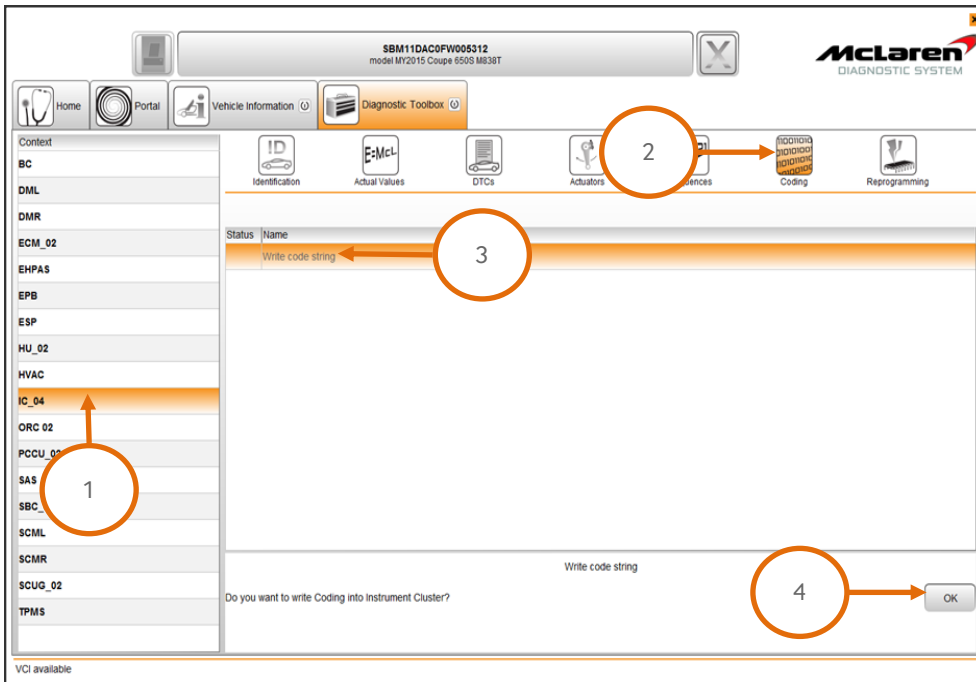


3. The following screen will appear once the IC coding has completed (5).

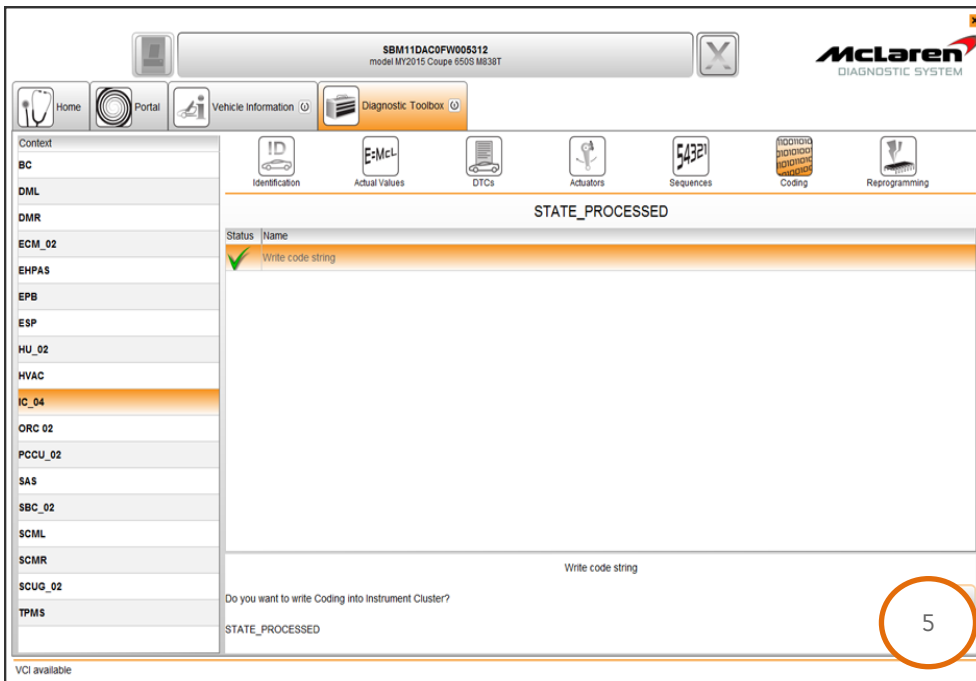


4. Select Sequences (6), select set car configuration defaults (7) then select the arrow button to proceed (8).

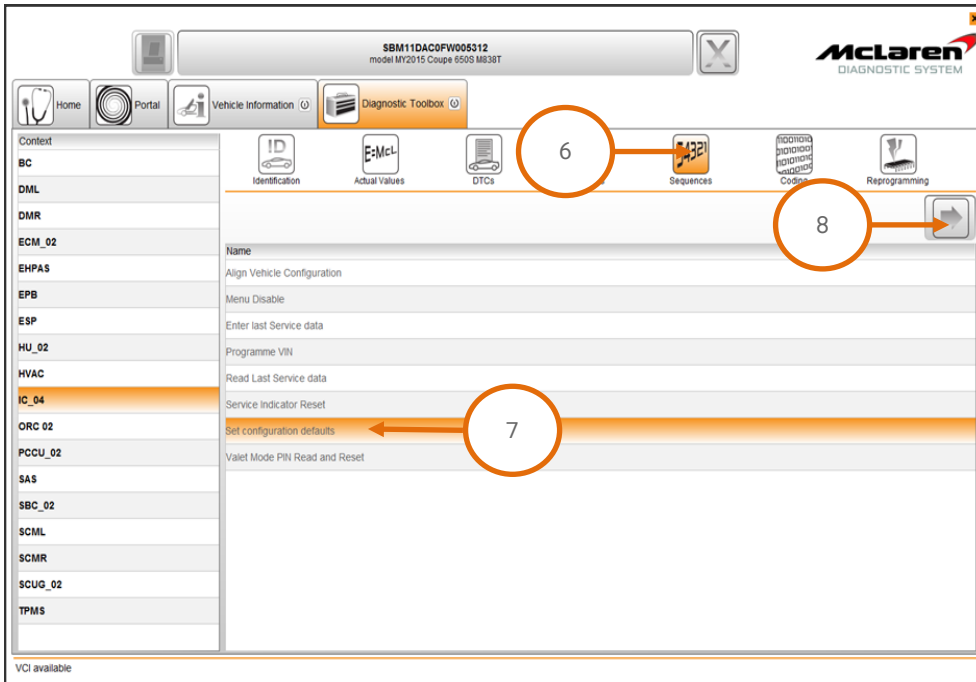

5. Proceed by selecting OK (9).

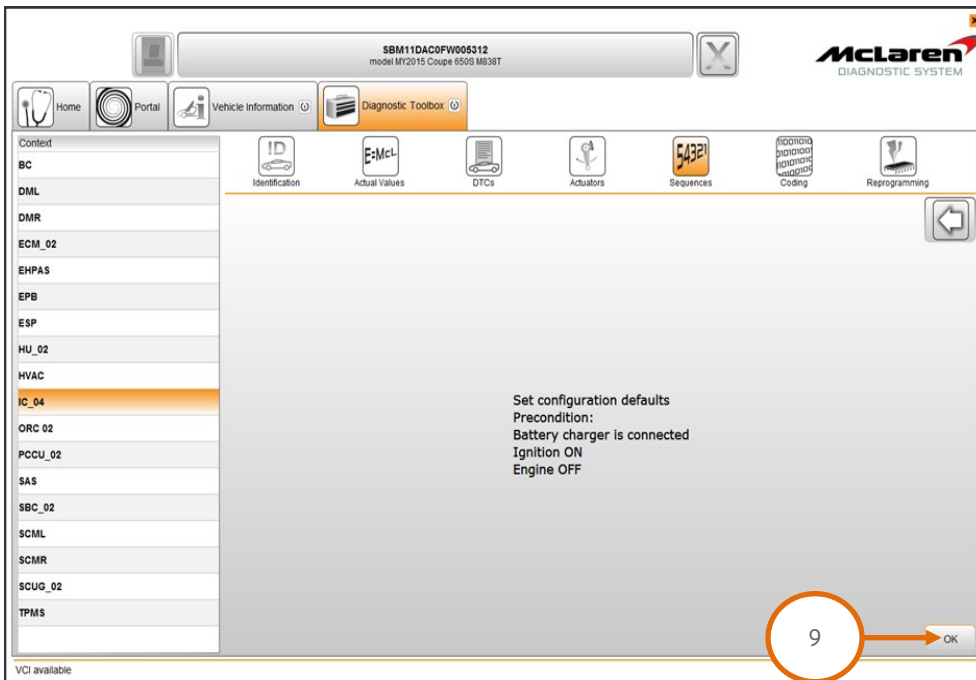

6. Then confirm the IC coding string has installed successfully, by checking via the Left-hand IC display that Intake Sound Generator **does not** appear in the menu below (10).

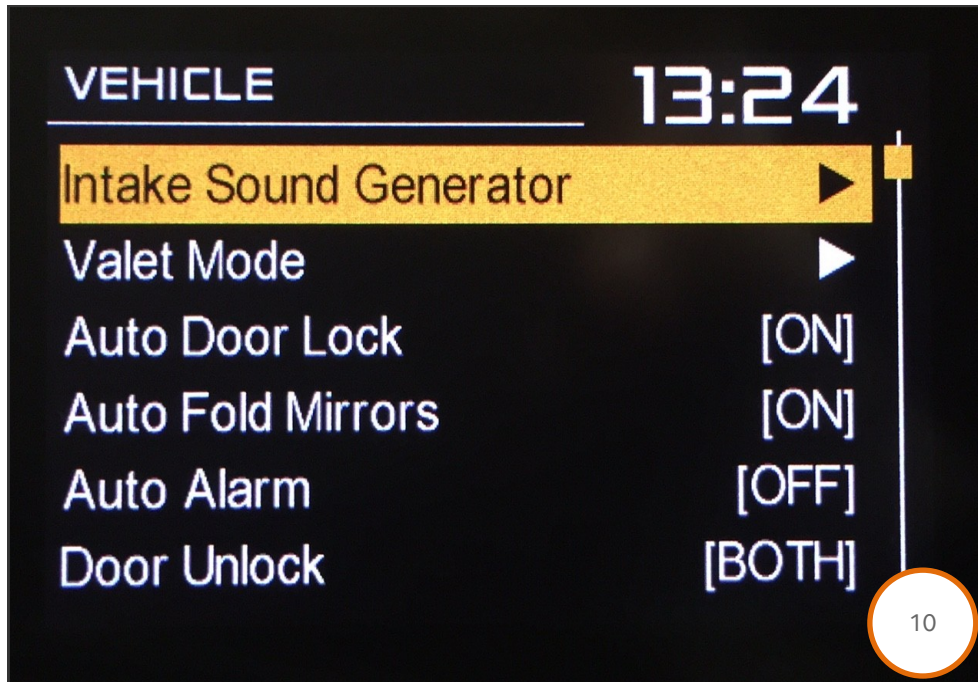

Please contact your Regional Aftersales Manager should you have any questions relating to the information contained in this bulletin.

WARRANTY INFORMATION

DESCRIPTION	RESOLUTION CODE	TOTAL REPAIR TIME
IC coding string update	M0M40130A2409907	0.30 hours

PARTS INFORMATION

DESCRIPTION	PART NUMBER	QUANTITY	ORDER PROCESS
N/A	N/A	N/A	N/A
N/A	N/A	N/A	N/A