

## TECH TIP

### 12MY-16MY COE CAB HARNESS CHAFE

**SUBJECT VEHICLES:** 12MY-16MY Hino cab-over-engine (COE) 195, 195h trucks

**Note:** This technical tip is provided as technical information and is not authorization for a warrantable repair.

#### OVERVIEW:

Subject vehicles may exhibit intermittent symptoms which include but are not limited to:

- ABS light
- Check engine light
- Vehicle CAN (Controller Area Network) communication concerns
- Inoperative speedometer
- Inoperative DEF level gauge
- Inoperative PAB (Power Assist Brake)

In the event that one or more of these symptoms occur, inspect for contact between the cab harness and the driver side front stabilizer bar link nut. If harness or circuit damage is found, repair the effected circuits and secure the harness to prevent future interference.

