



**NUMBER:** 18-037-15

**GROUP:** Vehicle Performance

**DATE:** April 30, 2015

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.

**HELP USING THE wiTECH DIAGNOSTIC APPLICATION FOR FLASHING AN ECU IS AVAILABLE BY SELECTING “HELP” THEN “HELP CONTENTS” AT THE TOP OF THE wiTECH DIAGNOSTIC APPLICATION WINDOW.**

**THE wiTECH SOFTWARE LEVEL MUST BE AT 15.04 OR HIGHER TO PERFORM THIS PROCEDURE.**

***SUBJECT:***

Flash: 5.7L P26AB Engine Coolant Bypass Valve Stuck

***OVERVIEW:***

This bulletin involves updating the Powertrain Control Module (PCM) with the latest software.

***MODELS:***

2015 (DS) Dodge Ram 1500 Pickup

**NOTE: This bulletin applies to vehicles built on or before April 16, 2015 (MDH 0416XX) equipped with a 5.7L engine (Sales Codes EZH) and the 8HP70 transmission (Sales Code DFK).**

***SYMPTOM/CONDITION:***

The customer may notice the Malfunction Indicator Lamp (MIL) turning on in the Instrument Panel Cluster (IPC). On further inspection the technician may find Diagnostic Trouble Code (DTC), P26AB - Engine Coolant Bypass Valve Stuck.

***DIAGNOSIS:***

Using a Scan Tool (wiTECH) with the appropriate Diagnostic Procedures available in TechCONNECT, verify all engine systems are functioning as designed. If DTCs or symptom conditions, other than the one listed above are present, record the issues on the repair order and repair as necessary before proceeding further with this bulletin.

For all other customers that describe the symptom/condition listed above or if the technician finds the DTC, perform the Repair Procedure.

***REPAIR PROCEDURE:***

**NOTE: Install a battery charger to ensure battery voltage does not drop below 13.2 volts. Do not allow the charging voltage to climb above 13.5 volts during the flash process.**

**NOTE: If this flash process is interrupted/aborted, the flash should be restarted.**

1. Reprogram the PCM with the latest available software. Detailed instructions for flashing control modules using the wiTECH Diagnostic Application are available by selecting the "HELP" tab on the upper portion of the wiTECH window, then "HELP CONTENTS." This will open the Welcome to wiTECH Help screen where help topics can be selected

**NOTE: After PCM reprogramming, the following must be performed.**

2. Clear any DTCs that may have been set in any modules due to reprogramming. The wiTECH application will automatically present all DTCs after the flash and allow them to be cleared.

***POLICY:***

Reimbursable within the provisions of the warranty.

***TIME ALLOWANCE:***

Labor Operation No:	Description	Skill Category	Amount
18-19-06-CU	Module, Powertrain Control (PCM) - Reprogram (0 - Introduction)	8 - Engine Performance	0.2 Hrs.

**NOTE: The expected completion time for the flash download portion of this procedure is approximately 3 minutes. Actual flash download times may be affected by vehicle connection and network capabilities.**

***FAILURE CODE:***

The dealer must choose which failure code to use. If the customer came in with an issue and the dealer found updated software to correct that issue, use failure code CC, for all other use failure code RF.

- If the customer's concern matches the SYMPTOM/CONDITION identified in the Service Bulletin, than failure code CC is to be used.
- If an available flash is completed while addressing a different customer concern, failure code RF is to be used.

CC	Customer Concern
RF	Routine Flash