

Classification:

EL14-049

Reference:

ITB15-007

COPYRIGHT© NISSAN NORTH AMERICA, INC.

Date:

February 2, 2015

2014 - 2015 Q50; POWER WINDOW AUTO-UP DOES NOT WORK

APPLIED VEHICLES: 2014 – 2015 Q50 Sedan (V37)

2014 – 2015 Q50 Hybrid (V37)

APPLIED VIN / DATE: 2014 models; all VINs / all Dates

2015 models:

Sedan 2WD built before JN1BV7AP(*)FM 332192 / Oct. 7, 2014

Sedan AWD built before JN1BV7AR(*)FM 392832 / Oct. 7, 2014

Hybrid 2WD built before JN1AV7AP(*)FM 790193 / Oct. 7, 2014

Hybrid AWD built before JN1AV7AR(*)FM 850198 / Oct. 7, 2014

IF YOU CONFIRM

A power window “auto-up” does not work for one or more power windows.

NOTE: This issue may occur using the main power window switch at the driver's door, or any passenger door power window switch.

ACTION

Replace the left front (driver) door finisher with the new one listed in the Parts Information.

- While replacing the door finisher, also replace the main power window switch.
- Refer to the Electronic Service Manual (ESM), section INT-Interior, for door finisher replacement information.

PARTS INFORMATION

DESCRIPTION	TRIM	PART NUMBER	QTY
Left Front (Driver) Door Finisher	G (Graphite)	80901-4HH0A	1
	C (Wheat)	80901-4HH0B	
	K (Stone)	80901-4HH0C	
Main Power Window Switch	With Automatic Drive Positioner (ADP)	25401-4GA6A	1
	Without Automatic Drive Positioner (ADP)	25401-4GA7A	

CLAIMS INFORMATION

Submit a Primary Part (PP) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
RPL One Inside Handle Finisher	(1)	UH40AA	ZE	32	(2)

(1) Refer to the Parts Information and use the appropriate Left Front Door Finisher P/N as the PFP.

(2) Reference the current Infiniti Warranty Flat Rate Manual and use the indicated Flat Rate Time.