

Classification:  
TF15-002

Reference:  
ITB15-014

COPYRIGHT© NISSAN NORTH AMERICA, INC.  
Date:  
March 17, 2015

## 2013 JX35 AND 2014 QX60 AWD ERROR DISPLAYED AND DTC C1204 STORED

**APPLIED VEHICLES:**      2013 JX35 (L50)  
   2014 QX60 (L50)  
   2014 QX60 Hybrid (L50) } Equipped with AWD

**APPLIED VIN / DATE:**      Built before 5N1(\*)L0M(\*\*)EC 548571 / August 5, 2014

### IF YOU CONFIRM

The vehicle has been operated in cold weather, below approximately -18°C (0°F),

and

AWD ERROR is displayed in the Vehicle Information Display,

and

DTC C1204 (AWD Solenoid) is stored.



Figure 1

### ACTION

Replace the AWD Control Unit with the one listed in the Parts Information of this bulletin.

- Refer to the Electronic Service Manual (ESM), section DLN-Driveline, for replacement information.

Infiniti Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Infiniti dealer to determine if this applies to your vehicle.

## SERVICE PROCEDURE

Replace the AWD Control Unit with the one listed in the Parts Information below (see Figure 2).

- Refer to the Electronic Service Manual (ESM), section DLN-Driveline, for replacement information.

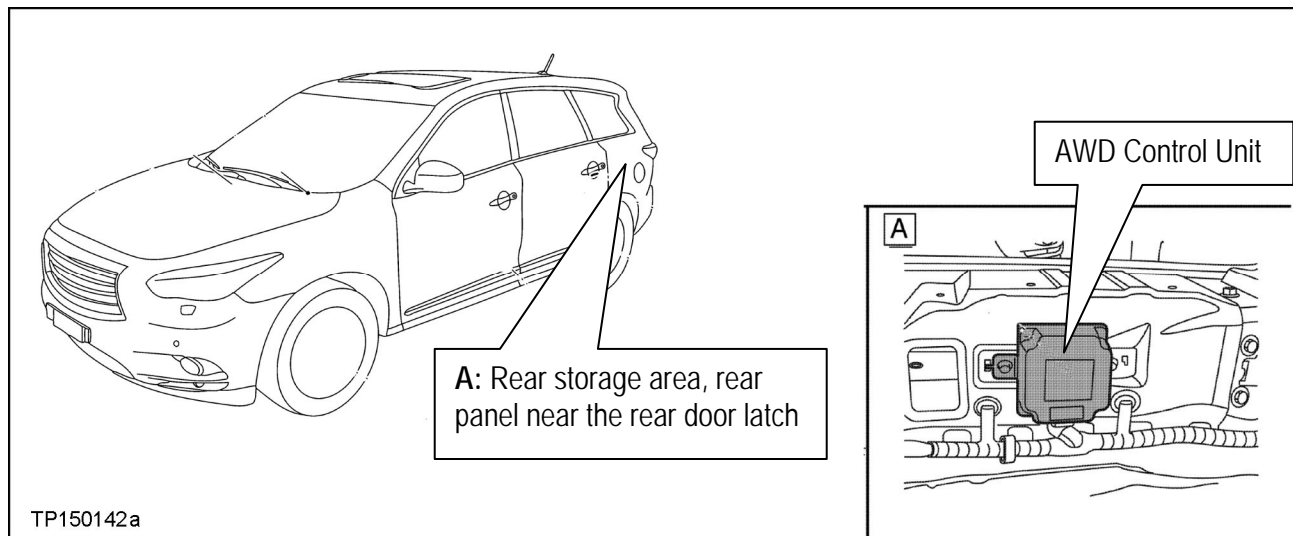


Figure 2

## PARTS INFORMATION

Description	P/N	Quantity
Controller Assy - Torque Split (AWD Control Unit)	41650 - 9NB5A	1

## CLAIMS INFORMATION

Submit a Primary Part (PP) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Replace Torque Split Control Unit	41650 - 9NB5A	RS36AA	ZE	32	(1)

(1) Reference the current Infiniti Warranty Flat Rate Manual and use the indicated flat rate time.