



## SERVICE BULLETIN

Classification:

TF15-001

Reference:

NTB15-021

Date:

March 17, 2015

### 2013 – 2014 PATHFINDER 4WD ERROR DISPLAYED AND DTC C1204 STORED

**APPLIED VEHICLES:** 2013 – 2014 Pathfinder (R52) } Equipped with 4WD  
2014 Pathfinder Hybrid (R52) }

**APPLIED VIN / DATE:** Built before 5N1(\*)R2M(\*\*)EC 721752 / August 5, 2014

#### IF YOU CONFIRM

The vehicle has been operated in cold weather, below approximately -18°C (0°F),

and

4WD ERROR is displayed in the Vehicle Information Display.

and

DTC C1204 (4WD Solenoid) is stored.



Figure 1

#### ACTION

Replace the 4WD Control Unit with the one listed in the Parts Information of this bulletin.

- Refer to the Electronic Service Manual (ESM), section DLN-Driveline, for replacement information.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

## SERVICE PROCEDURE

Replace the 4WD Control Unit with the one listed in the Parts Information below (see Figure 2).

- Refer to the Electronic Service Manual (ESM), section DLN-Driveline, for replacement information.

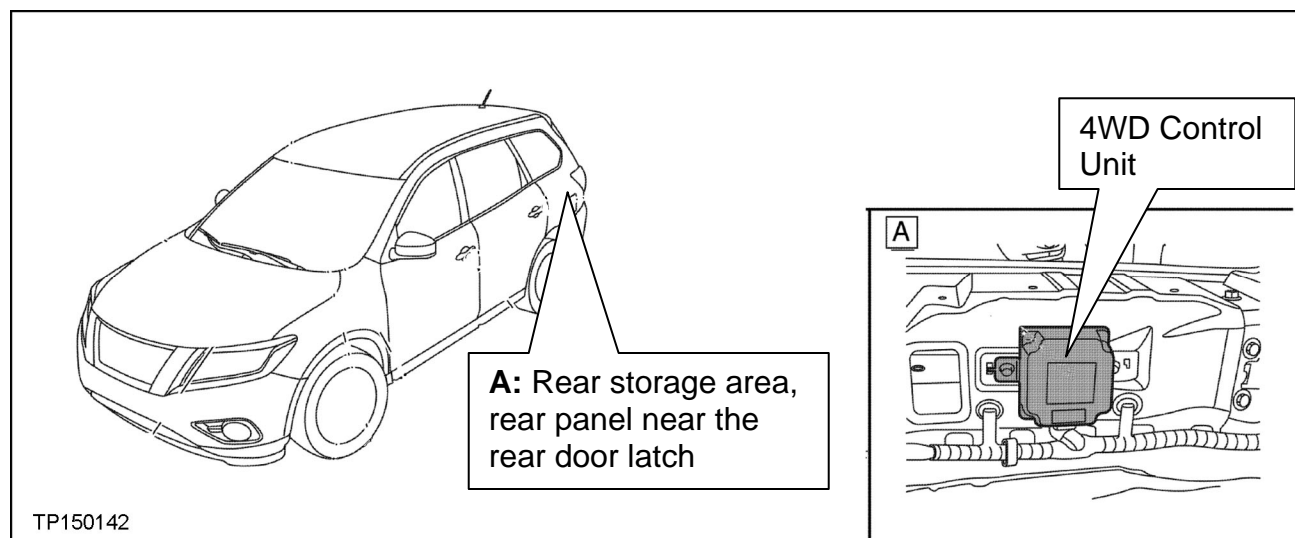


Figure 2

## PARTS INFORMATION

DESCRIPTION	P/N	QUANTITY
Controller Assy - Torque Split (4WD Control Unit)	41650 – 9PB5A	1

## CLAIMS INFORMATION

Submit a Primary Part (PP) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Replace Torque Split Control Unit	41650 – 9PB5A	RS36AA	ZE	32	(1)

(1) Reference the current Nissan Warranty Flat Rate Manual and use the indicated flat rate time.