



RECALL CAMPAIGN BULLETIN

Reference:

NTB15-033a

Date:

August 12, 2015

VOLUNTARY SAFETY RECALL CAMPAIGN 2012-2015 VERSA SEDAN AND 2014-2015 VERSA NOTE CENTER CONSOLE DRIVER'S SIDE LOWER FINISHER

This bulletin has been amended. Previous Service Campaign has been reclassified as Voluntary Safety Recall Campaign. Please discard previous versions of this bulletin.

CAMPAIGN ID #: P5308

APPLIED VEHICLES: 2012-2015 Versa Sedan (N17)
2014-2015 Versa Note (E12)

Check Service COMM to confirm campaign eligibility.

INTRODUCTION

Nissan is conducting a Voluntary Safety Recall Campaign on certain specific Model Year 2012 – 2015 Versa Sedan and 2014 – 2015 Versa Note vehicles to remove material from the Center Console Lower. This service will be performed at no charge for parts or labor.

IDENTIFICATION NUMBER

Nissan has assigned identification number P5308 to this campaign. This number must appear on all communication and documentation of any nature dealing with this campaign.

DEALER RESPONSIBILITY

It is the dealer's responsibility to check Service COMM for the campaign status on each vehicle falling within the range of this voluntary safety recall campaign which for any reason enters the service department. This includes vehicles purchased from private parties or presented by transient (tourist) owners and vehicles in a dealer's inventory. **Federal law requires that new vehicles in dealer inventory which are the subject of a safety recall must be corrected prior to sale. Failure to do so can result in civil penalties by the National Highway Traffic Safety Administration.** While federal law applies only to new vehicles, Nissan strongly encourages dealers to correct any used vehicles in their inventory before they are retailed.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

SERVICE PROCEDURE

1. Remove the Center Console Assembly.

- For vehicles with a manual transmission proceed to step 2.

NOTE: On manual transmission vehicles, DO NOT remove the shifter knob from the shift lever or damage will occur to the shifter assembly.

- **For vehicles with a CVT**, refer to the Electronic Service Manual (ESM), section **IP – Instrument Panel**, to remove the Center Console Assembly and then proceed to step 7.

2. Remove the two clips from the front and two TORX (T20) screws from the rear of the Center Console Assembly.

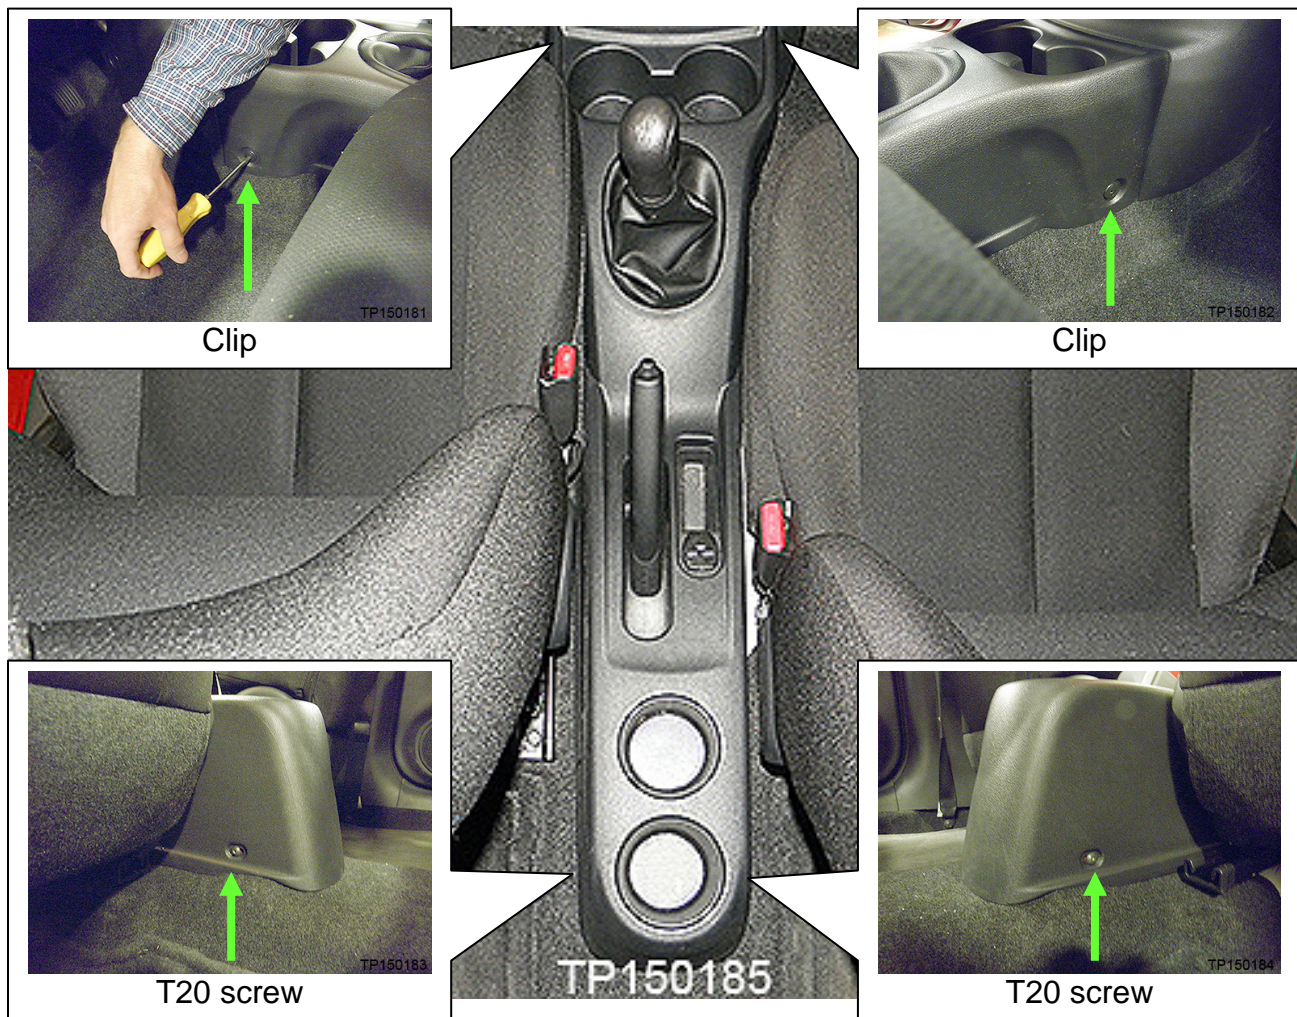


Figure 1

3. Pull the parking brake lever to the highest position to allow the Center Console Assembly to be repositioned.



Figure 2

4. Lift the rear of the Center Console Assembly (Figure 3) and disconnect the two harness retainers that attach the harness to the vehicle floor.

NOTE:

- Figure 3 is shown with the Center Console Assembly removed to show retainers.
- Do not disconnect the harness from the Center Console Assembly.

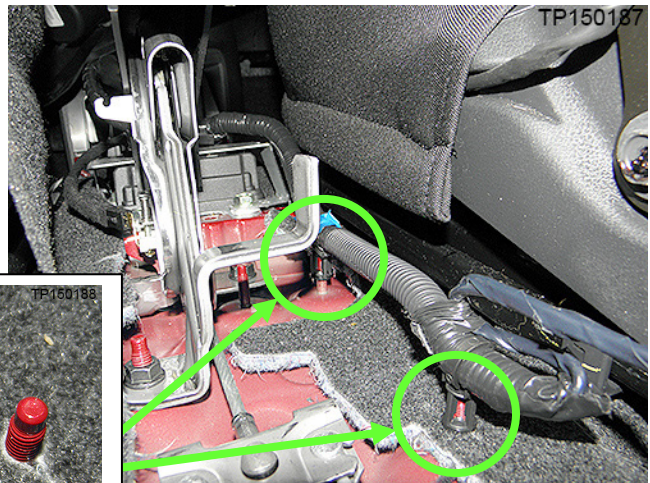


Figure 3



5. Lift the Center Console Assembly at the front to separate it from the Center Console Lower.

NOTE: On manual transmission vehicles, DO NOT remove the shifter knob from the shift lever or damage will occur to the shifter assembly.

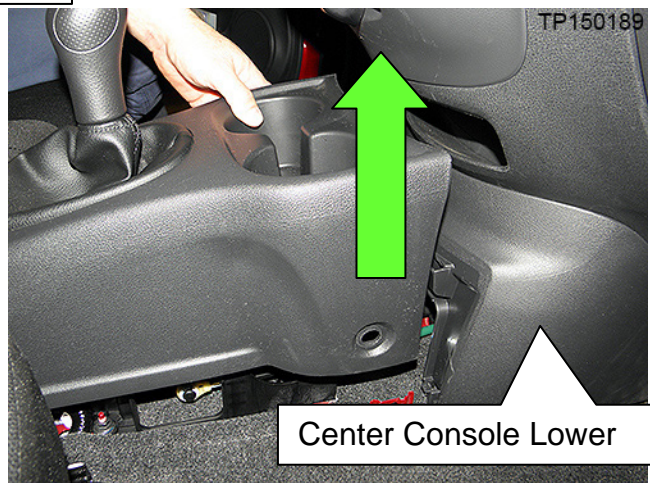


Figure 4

- Lift the Center Console Assembly off of the parking brake lever and turn the entire assembly 90°, and then rest it on the front seats (Figure 5).

NOTE: place a clean fender cover between the Center Console Assembly and the seats.

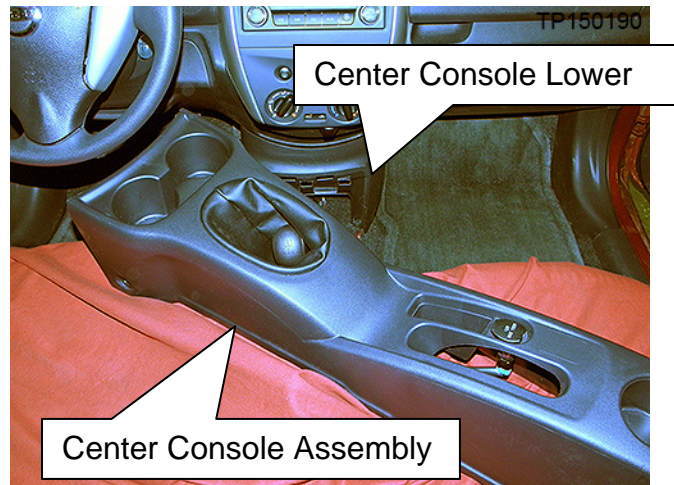


Figure 5

- Remove the Center Console Lower (Figure 6).
 - Remove right and left side clips.

NOTE: Left side shown. Right side similar.
 - Detach three hidden integral clips at top of Center Console Lower and remove it from the vehicle.

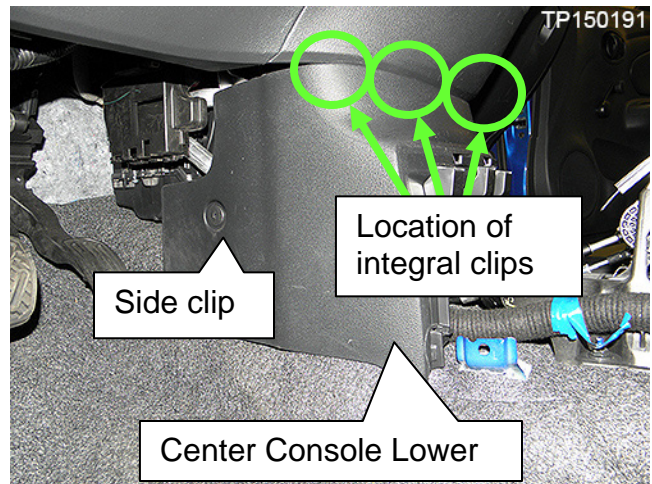


Figure 6

- Tape the Center Console Lower on front and back with 100 mm (approximately 4 inches) of masking tape as shown in Figure 7.

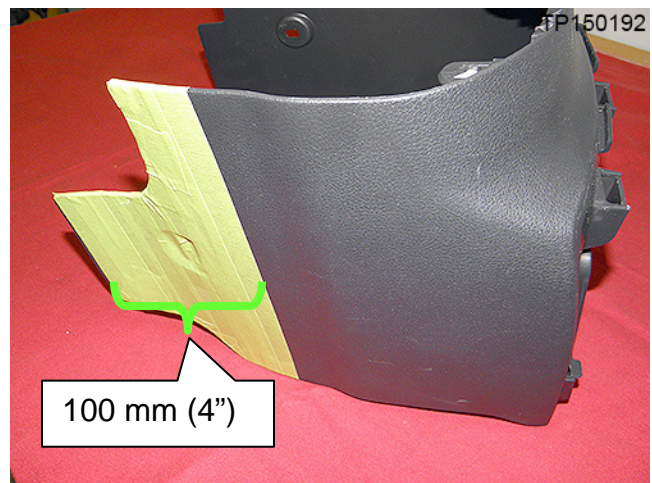


Figure 7

9. Measure 30 mm (approximately 1 3/16 inches) from driver's side leading edge of the Center Console Lower and then draw a line parallel to the same leading edge (Figure 8).

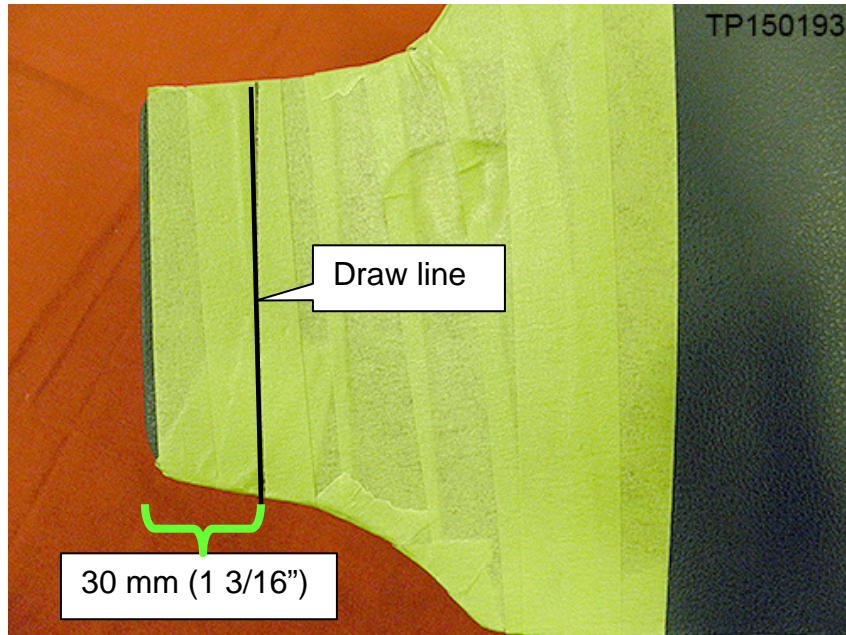


Figure 8

10. Measure 80 mm (approximately 3 1/8 inches) from driver's side leading edge of the Center Console Lower and then draw a line parallel to the same leading edge (Figure 9).

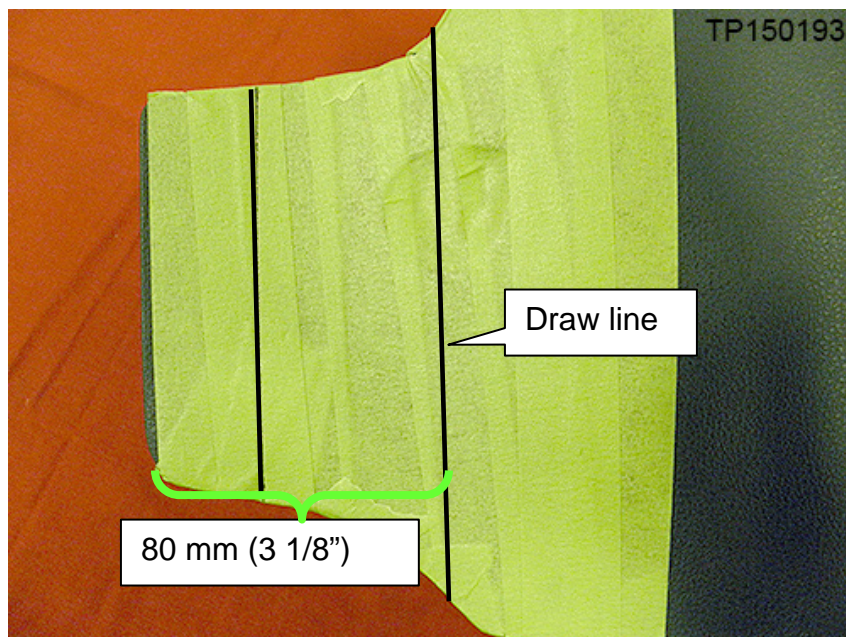


Figure 9

11. Draw a diagonal line from the top of the 30 mm line (step 9) to the bottom of the 80 mm line (step 10) on the Center Console Lower (Figure 10).

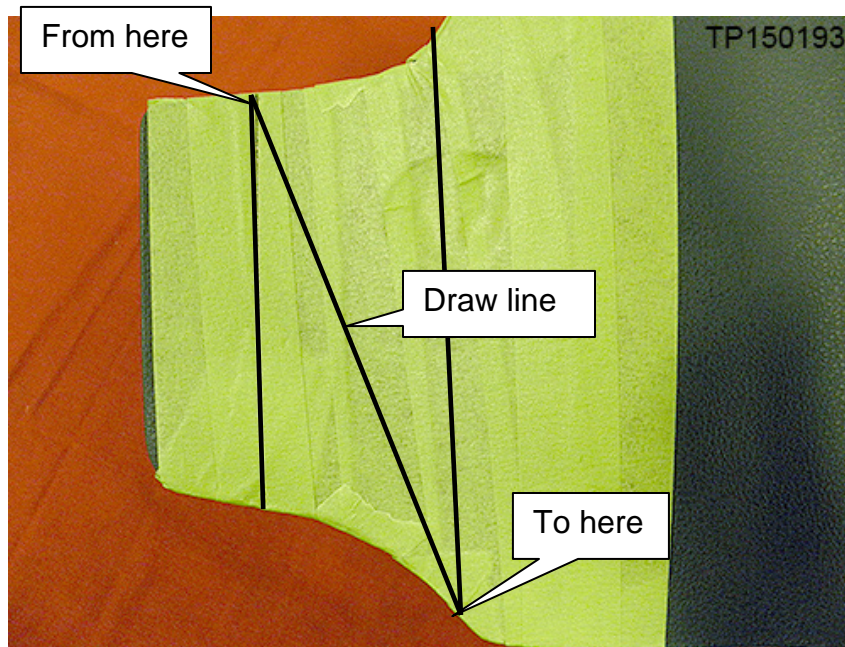


Figure 10

12. Using large sturdy scissors, cut along the diagonal line.

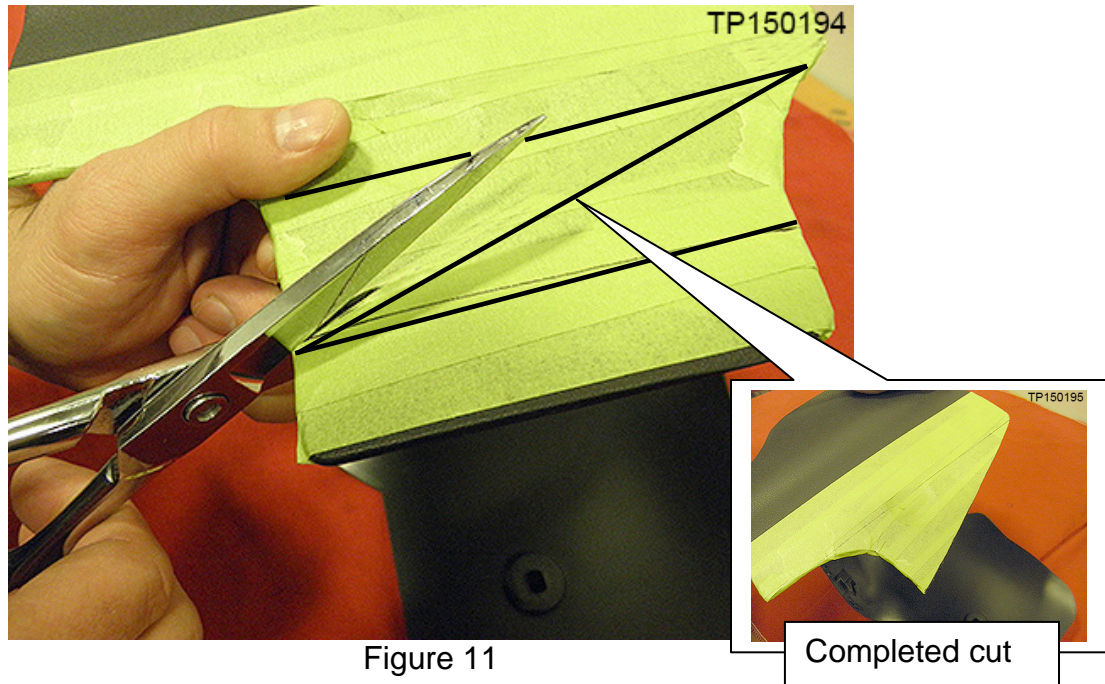


Figure 11

13. Round the upper corner with sturdy scissors (Figure 12).

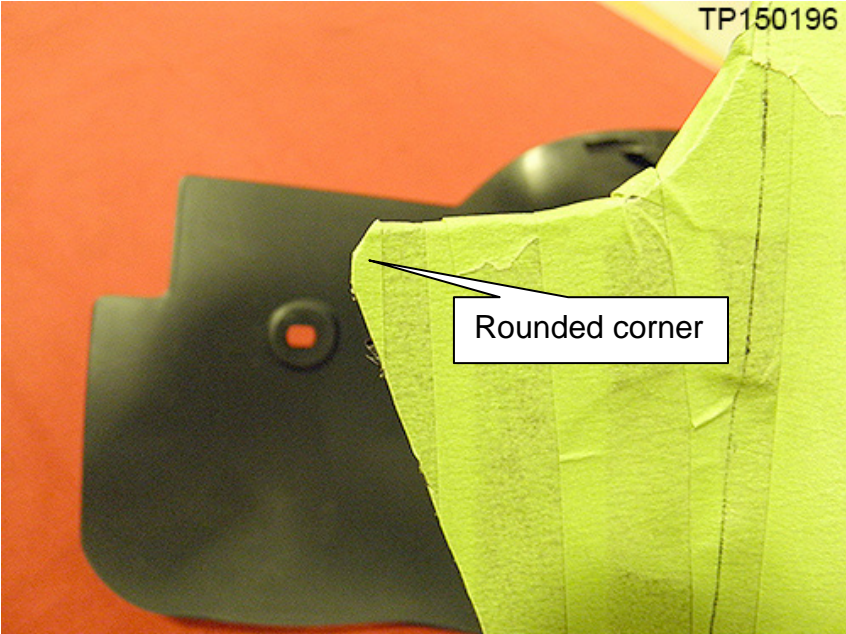


Figure 12

14. Lightly sand the rough edges where the cuts were made with fine sand paper to provide a smooth and finished look (Figure 13).

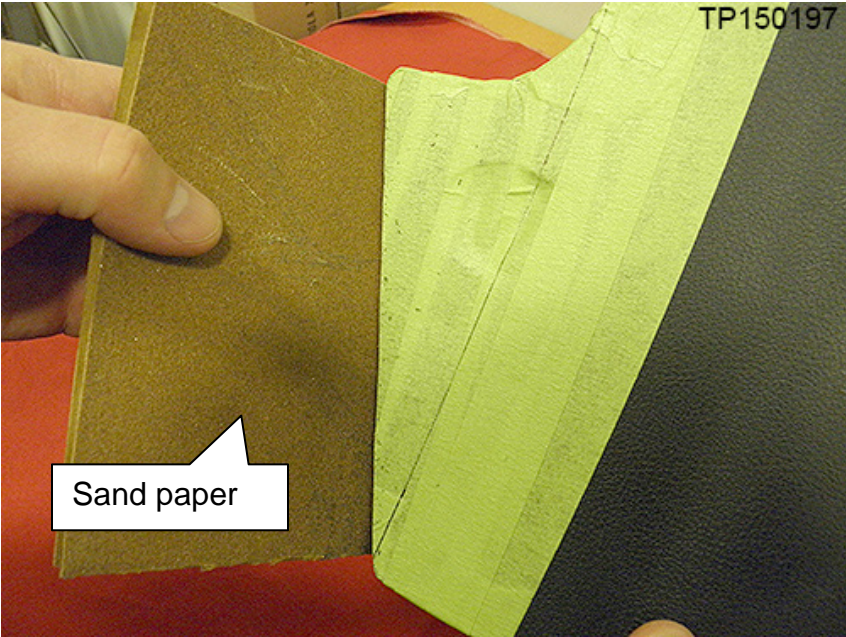


Figure 13

15. Remove masking tape from the Center Console Lower.
16. After the tape is removed, clean any remaining tape residue from the surface of the Center Console Lower.



Figure 14

17. Reinstall the Center Console Lower and Center Console Assembly in the reverse order.

CLAIMS INFORMATION

Submit a Campaign (CM) line claim using the following claims coding:

CAMPAIGN (CM) ID #	DESCRIPTION	OP CODE	FRT
P5308	Re-shape Lower Instrument Center Cover	P53080	0.5 hrs.

