



SERVICE BULLETIN

Classification: EM15-004	Reference: NTB15-097	Date: November 5, 2015
-----------------------------	-------------------------	---------------------------

2014-2015 NV; COOLANT LEAK FROM HEATER HOSE BLEEDER CAP

APPLIED VEHICLES: 2014-2015 NV Cargo (F80)
2014-2015 NV Passenger (F80)

APPLIED ENGINES: V6 and V8

IF YOU CONFIRM:

Coolant is leaking from the connector cap (bleeder cap).

- The bleeder cap may show signs of cracking (see pictures on the next page).

NOTE: The bleeder cap may not be fully seated down (see pictures on the next page).

ACTION:

1. Remove the bleeder cap:

NOTE: Follow all warnings, cautions, and notes in the Electronic Service Manual (ESM) when working on the vehicle's cooling system.

- Partially drain the cooling system.
 - Refer to the ESM, section **CO-Engine Cooling System**, for coolant draining.
- Remove the bleeder cap by pinching its clamp with a suitable tool.

2. Install the new bleeder cap in reverse order of removal.

- The new bleeder cap is listed in the **PARTS INFORMATION**.
- Make sure the bleeder cap is fully seated against the heater hose junction (see Figures 3 and 4 on the next page).

NOTE: Do not replace the heater hose assembly for this incident, if it should occur.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

Figure 2 shows NV Passenger with rear heater piping (not equipped on NV Cargo).
NOTE: There is only one bleeder cap per vehicle – NV Passenger's is on the right, NV Cargo's on the left (its location is hidden in Figure 2).

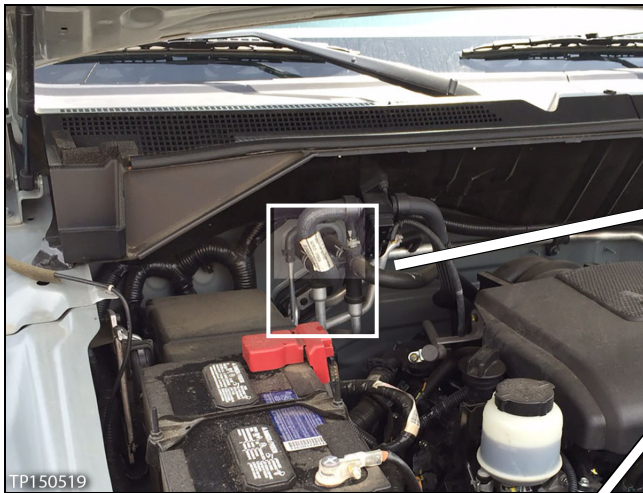


Figure 1

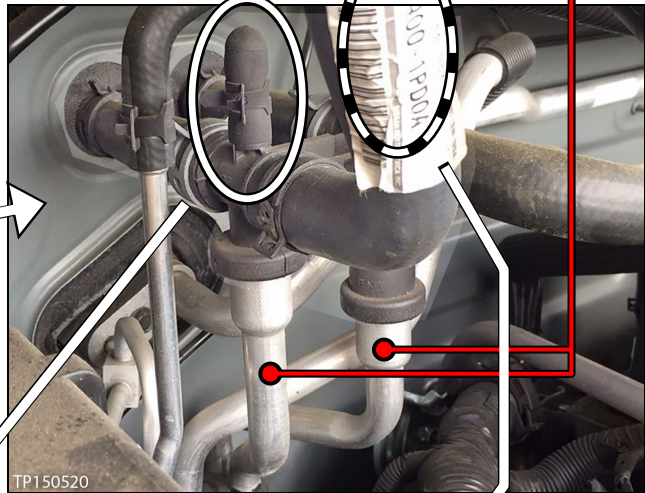


Figure 2

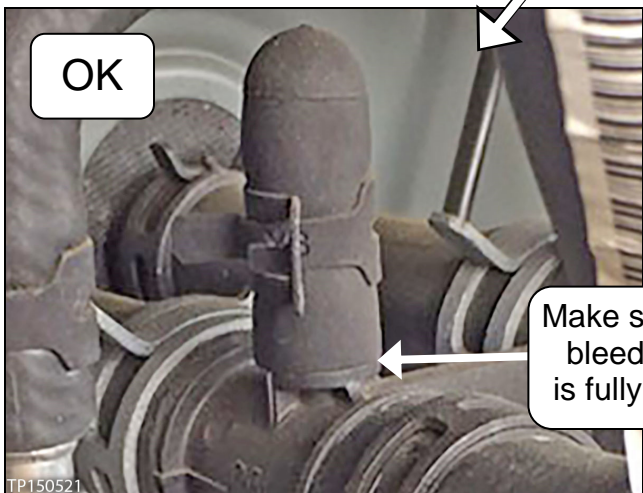


Figure 3; NV Passenger only

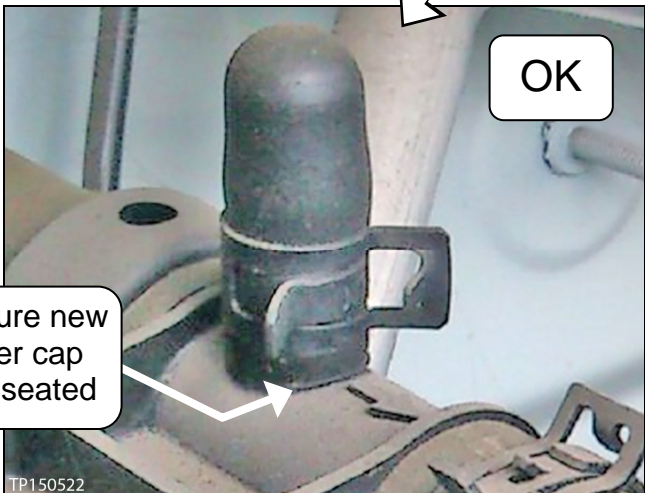


Figure 4; NV Cargo only



Figure 5

PARTS INFORMATION

DESCRIPTION	PART #	QUANTITY
CAP-CONNECTOR (bleeder cap)	92570-51E00	1
Blue Nissan Long Life Antifreeze/Coolant (1)	999MP-L25500P (2)	as needed

(1) For warranty repairs, genuine Nissan antifreeze/coolant **must** be used. For customer pay repairs, genuine Nissan antifreeze/coolant or an equivalent is recommended.

(2) This product can be ordered through the Nissan Maintenance Advantage program: Phone: 877-NIS-NMA1 (877-647-6621) or Website: Order via link on dealer portal www.NNAnet.com and click on the "Maintenance Advantage" link.

CLAIMS INFORMATION

Submit a Primary Part (PP) type claim using the following claim coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Rpl Bleeder Cap	92570-51E00	CX25AA	ZQ	32	0.2

